

General Information

Date & Time: 04, Mar, 2025 09:18

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,674
Registration No.	NFR7281	Chassis No.	PA1B18F3XR4253374
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



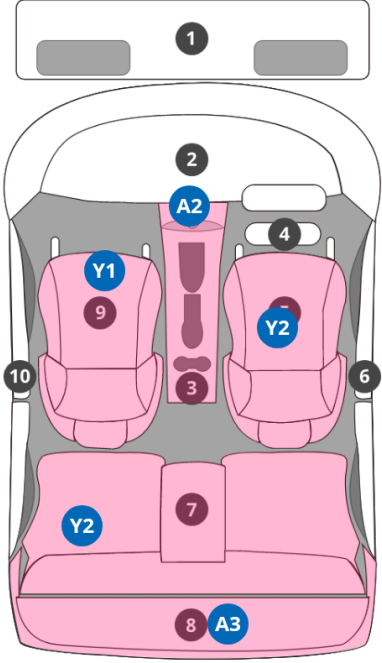
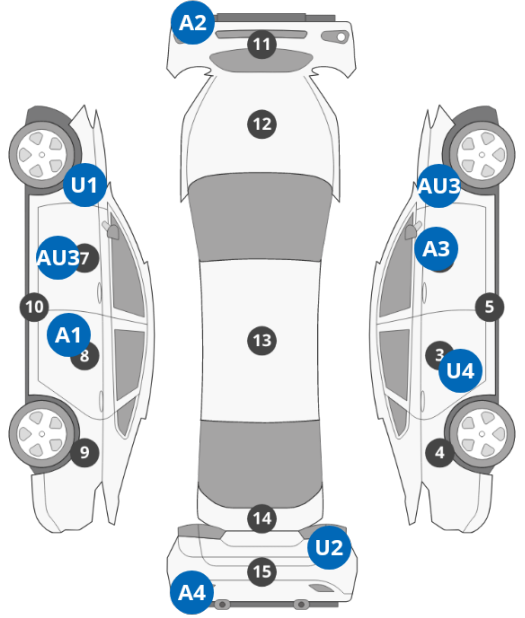
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	109	110	110
2	Boot Lid	105.0	103	103	109
3	Roof	98.6	103	94	95/103
4	Left Front Fender	96.0	100	93	96
5	Left Front Door	95.0	93	99	93
6	Center Panel Left				
7	Left Rear Door	99.8	99	99	102
8	Left Back Panel	99.2	109	96	93
9	Right Front Fender	101.6	106	96	103
10	Right Front Door	95.3	90	94	102
11	Center Panel Right				
12	Right Rear Door	97.6	97	92	103
13	Right Back Panel	101.5	96	101	108

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Knobs - Worn, Peel, Crack - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Dent - Large / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/ with jack and incomplete tools/with warranty booklet