

General Information

Date & Time: 20, Jul, 2026 15:12

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	43,771
Registration No.	NHH5058	Chassis No.	MR0DB8CD0R0195105
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



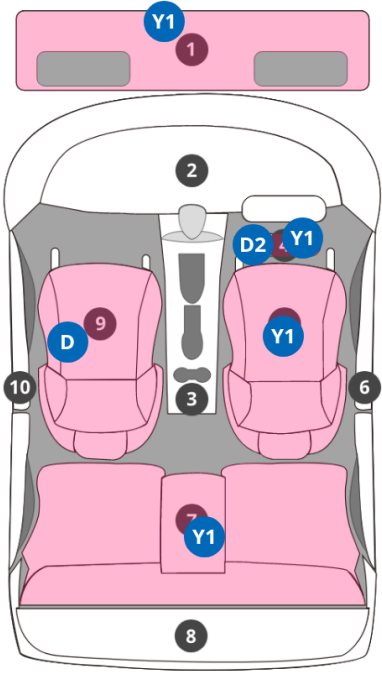
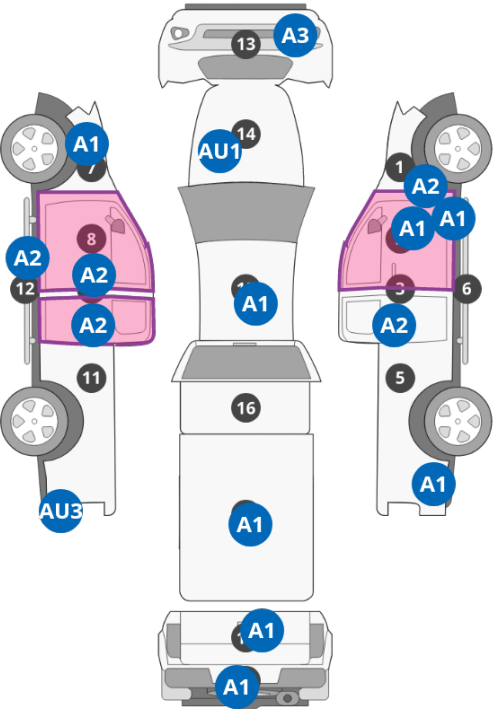
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	110	107	116
2	Boot Lid	92.7	96	85	97
3	Roof	97.7	94	87	100/110
4	Left Front Fender	92.0	89	90	98
5	Left Front Door	298.3	150	127	618
6	Center Panel Left				
7	Left Rear Door	135.0	171	111	123
8	Left Back Panel	99.3	94	97	107
9	Right Front Fender	95.4	97	96	93
10	Right Front Door	241.6	446	146	133
11	Center Panel Right				
12	Right Rear Door	87.8	87	87	90
13	Right Back Panel	103.3	100	105	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Minimal / Cargo Bed Floor - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with tools and jack/with spare tire/no spare key/tailight issue/scratches on tailight cover/hairline scratches on the body