

General Information

Date & Time: 20, Jul, 2026 15:31

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	24,239
Registration No.	DCC1942	Chassis No.	MHFAA1BY0S0053797
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



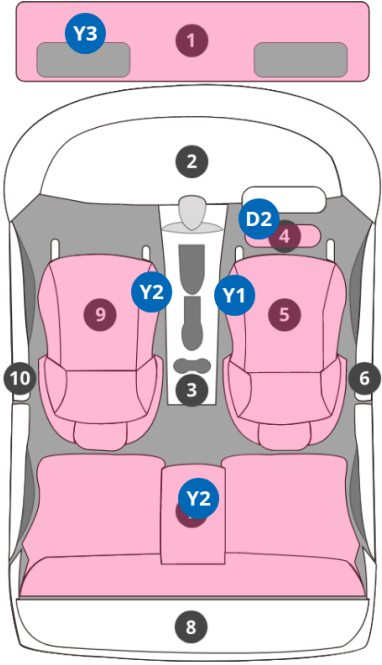
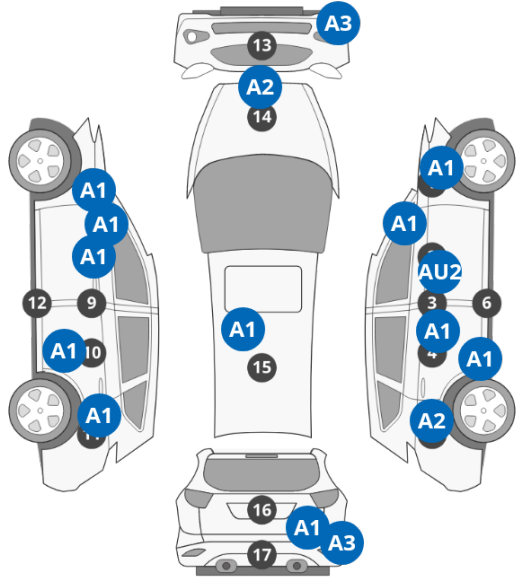
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	120	111	122
2	Boot Lid	115.3	106	123	117
3	Roof	122.5	131	124	117/118
4	Left Front Fender	113.0	113	116	110
5	Left Front Door	130.6	129	129	134
6	Center Panel Left				
7	Left Rear Door	131.0	121	129	143
8	Left Back Panel	126.6	129	122	129
9	Right Front Fender	106.6	110	110	100
10	Right Front Door	121.0	128	119	116
11	Center Panel Right				
12	Right Rear Door	118.6	125	116	115
13	Right Back Panel	132.3	138	133	126

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Medium	Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light