

General Information

Date & Time: 20, Jul, 2026 09:50

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	35,384
Registration No.	NJK2045	Chassis No.	PAHACACA4S6428066
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



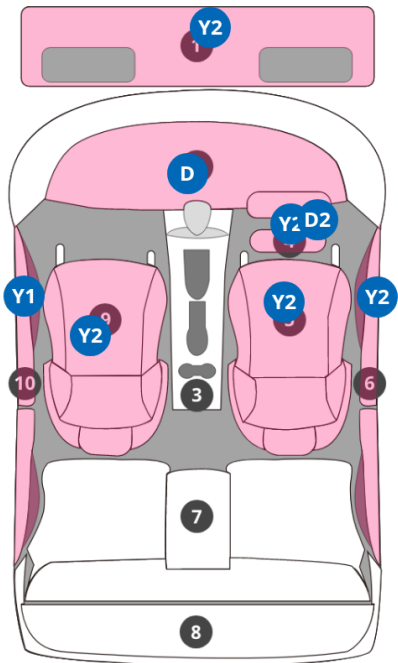
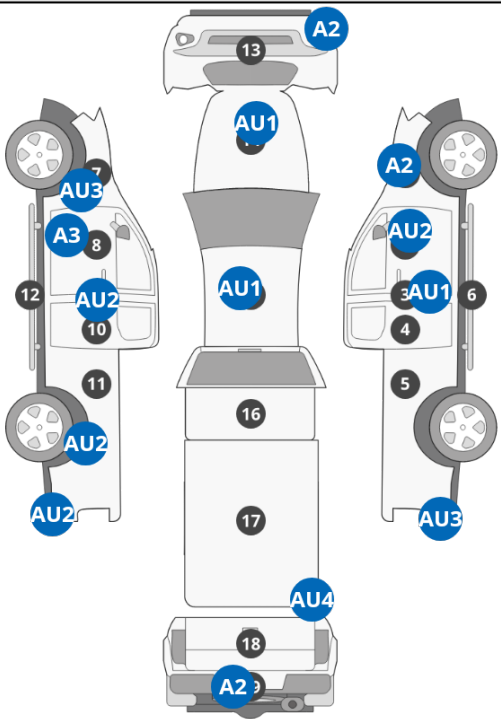
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	102	104	100
2	Boot Lid	42.7	58	60	10
3	Roof	121.5	125	118	126/117
4	Left Front Fender	86.7	108	118	34
5	Left Front Door	103.3	106	105	99
6	Center Panel Left	84.6	91	82	82
7	Left Rear Door				
8	Left Back Panel	71.1	68	73	72
9	Right Front Fender	108.0	106	113	105
10	Right Front Door	105.0	101	105	109
11	Center Panel Right	107.6	111	105	107
12	Right Rear Door				
13	Right Back Panel	80.1	82	78	80

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Crinkle - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Minimal / (L) Side Gate - Scratch & Dent - Small / (L) Guard Frame - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Guard Frame - Scratch & Dent - Medium / Cab Back Panel - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with warranty and manual booklet, with jack, scratches in taillight and headlight, no spare key, scratches and dent on exterior.