

General Information

Date & Time: 16, Jul, 2026 15:42

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	20,034
Registration No.	DCD8789	Chassis No.	PAHACACA6S6430286
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



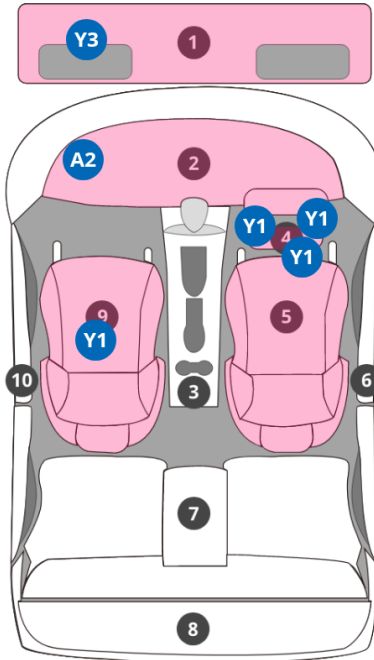
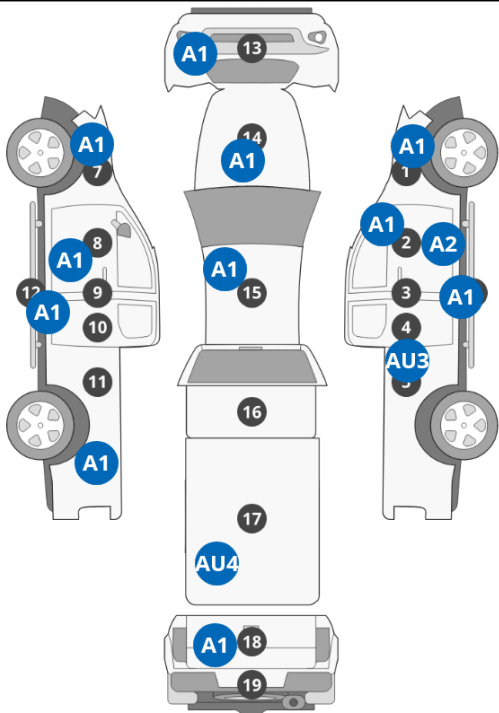
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	141.3	150	158	116
2	Boot Lid	74.3	65	62	96
3	Roof	115.2	126	115	113/107
4	Left Front Fender	127.3	123	121	138
5	Left Front Door	107.0	109	102	110
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	78.5	75	78	83
9	Right Front Fender	152.0	146	141	169
10	Right Front Door	107.0	100	107	114
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	84.8	76	78	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Dash-board - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / Ceiling - Grime - Medium		Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch & Dent - Large / (L) Side Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes	

Inspector Notes

with Ito plate/without warrany booklet/with jack and tools/with spare tire/with spare key/with hairlines scatches on the body/without reverse camera