

General Information

Date & Time: 20, Jul, 2026 09:16

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	17,847
Registration No.	NKS6593	Chassis No.	PAHAD9DA3S1627990
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	MPV
Colour	Black		

Body / Panel Condition



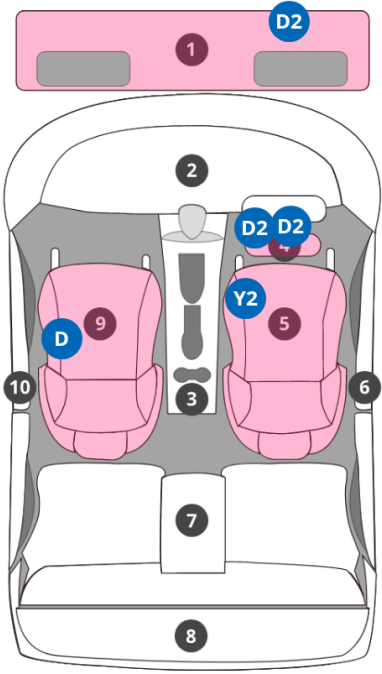
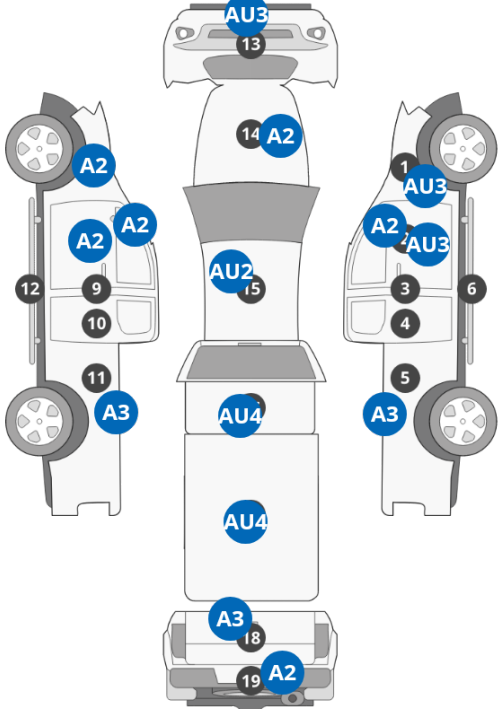
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.6	154	148	150
2	Boot Lid	114.6	105	107	132
3	Roof	137.2	146	154	144/105
4	Left Front Fender	158.3	159	151	165
5	Left Front Door	144.3	158	146	129
6	Center Panel Left	136.3	142	142	125
7	Left Rear Door				
8	Left Back Panel	120.3	107	147	107
9	Right Front Fender	164.0	168	172	152
10	Right Front Door	119.0	121	119	117
11	Center Panel Right	136.6	147	121	142
12	Right Rear Door				
13	Right Back Panel	128.3	108	104	173

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Ceiling - Crinkle - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / Cargo Bed Floor - Scratch & Dent - Large / Cab Back Panel - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Medium / (L) Side Gate - Scratch - Medium / (R) Side Gate - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light, daytime running light issue, watermarks on headlight