

General Information

Date & Time: 14, Jul, 2026 15:57

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	12,780
Registration No.	NJK7133	Chassis No.	PAHACACA4S6429315
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



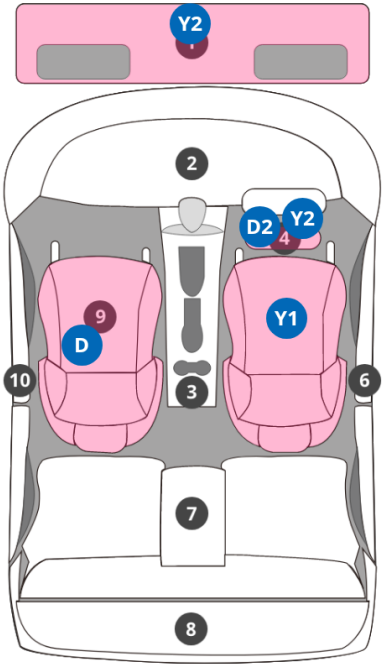
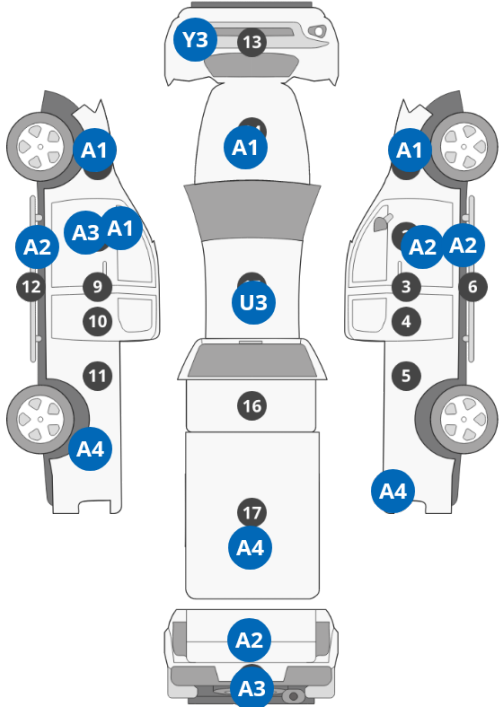
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.1	100	103	92
2	Boot Lid	51.9	62	44	49
3	Roof	115.5	122	124	105/111
4	Left Front Fender	104.3	101	108	104
5	Left Front Door	106.3	102	110	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	51.6	51	52	52
9	Right Front Fender	104.3	110	107	96
10	Right Front Door	107.3	104	109	109
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	52.8	48	62	49

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (L) Front Seat - Worn - Yes	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Dent - Medium / (L) Side Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch - Large / (R) Side Gate - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with warranty booklet/with tools and jack/with spare tire/scratches on taillight cover/hairline scratches on the body/with spare key/scratches on side windows