

General Information

Date & Time: 14, Jul, 2026 16:01

Make	Toyota	Model	Veloz
YOM	2025	Odo Meter Reading	15,563
Registration No.	NJA9506	Chassis No.	MHFAB1BY2S3136482
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



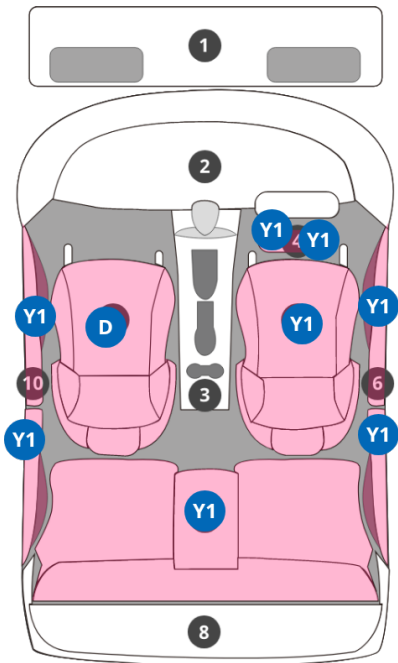
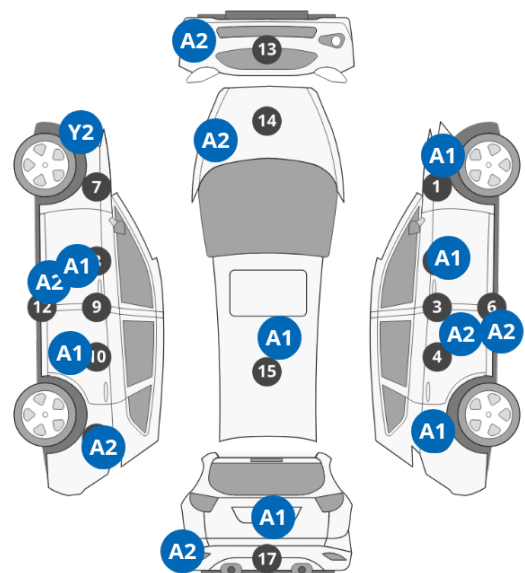
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	83.3	84	81	85
2	Boot Lid	99.7	93	111	96
3	Roof	115.0	123	119	106/112
4	Left Front Fender	106.0	110	104	104
5	Left Front Door	121.0	113	124	126
6	Center Panel Left				
7	Left Rear Door	115.6	119	111	117
8	Left Back Panel	128.6	141	127	118
9	Right Front Fender	104.3	104	106	103
10	Right Front Door	120.0	125	121	114
11	Center Panel Right				
12	Right Rear Door	115.3	116	115	115
13	Right Back Panel	121.0	109	115	139

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/with spare key/with seat cover/hairline scratches on the body/fog lights issue