

General Information

Date & Time: 03, Mar, 2025 12:09

Make	Toyota	Model	Wigo
YOM	2021	Mileage	42,826
Registration No.	CBL3053	Chassis No.	MHKA4DF5FLJ049765
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



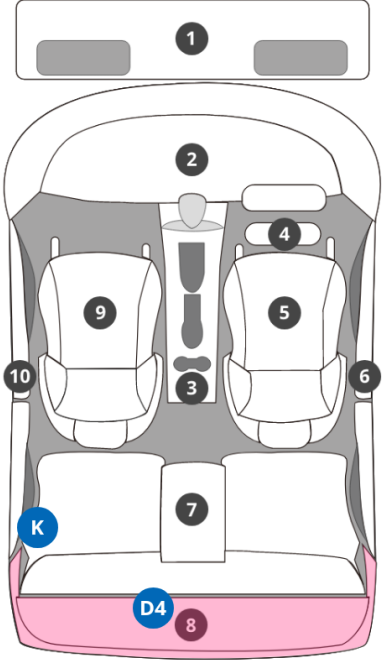
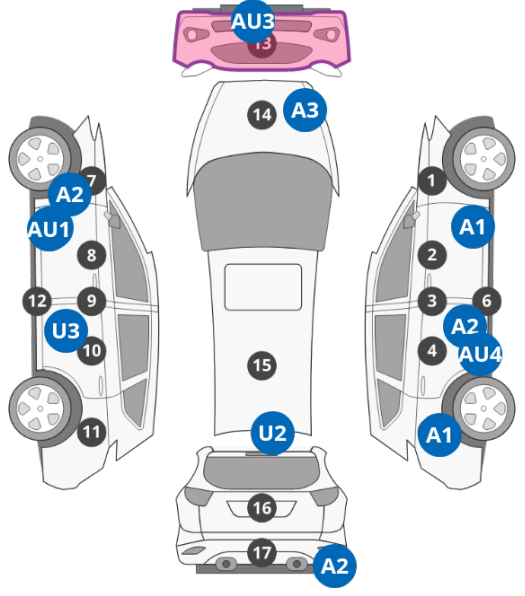
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.3	94	101	85
2	Boot Lid	107.3	106	111	105
3	Roof	81.6	75	90	81/80
4	Left Front Fender	100.4	96	105	100
5	Left Front Door	94.0	96	94	93
6	Center Panel Left				
7	Left Rear Door	96.1	101	95	93
8	Left Back Panel	97.8	111	95	88
9	Right Front Fender	174.6	152	177	195
10	Right Front Door	122.6	121	124	123
11	Center Panel Right				
12	Right Rear Door	139.0	141	138	138
13	Right Back Panel	92.5	95	90	93

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Trunk Room - Loose, Deformed - Large	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Roof - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ with jack and spare tire/ with tools and LTO plate