

General Information

Date & Time: 22, Jul, 2026 07:38

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	171,240
Registration No.	NAP3423	Chassis No.	PA1B19F35J4061080
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



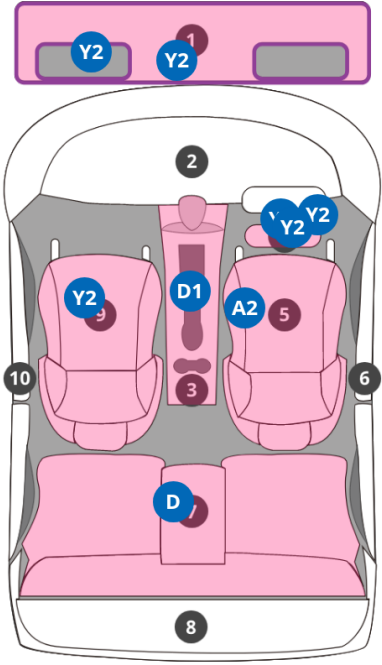
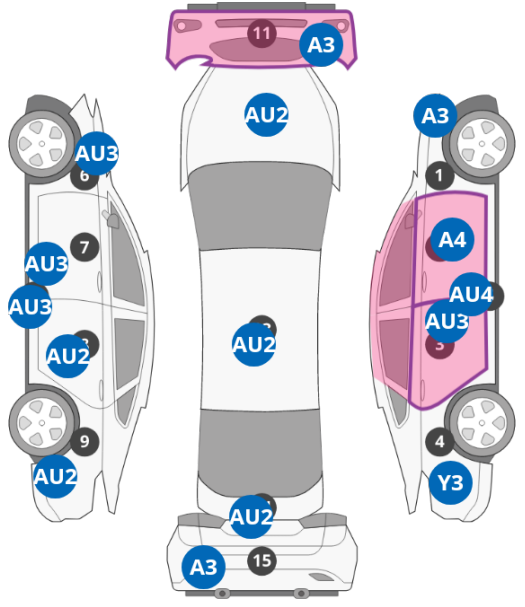
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	184.6	173	189	192
2	Boot Lid	126.3	128	121	130
3	Roof	123.0	124	122	116/130
4	Left Front Fender	181.3	181	179	184
5	Left Front Door	216.3	224	186	239
6	Center Panel Left				
7	Left Rear Door	99.0	101	109	87
8	Left Back Panel	185.6	202	175	180
9	Right Front Fender	199.3	230	180	188
10	Right Front Door	186.6	193	171	196
11	Center Panel Right				
12	Right Rear Door	203.3	219	179	212
13	Right Back Panel	188.3	195	165	205

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Fray - Small / Rear Seat - Worn - Yes / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Console, Switchs, Vents - Worked - Minimal / Room Lamp - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes

Inspector Notes

with LTO plate, with spare tire, no tools and jack, no warranty and manual booklet, no spare key, issue in foglamps, issue in headlight, scratches and yellowing in headlight and taillight, scratches and dent on exterior, scratches on taillight and headlight, idle vibration, horn issue.