

General Information

Date & Time: 14, Jul, 2026 15:51

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	190,883
Registration No.	NAJ9472	Chassis No.	PA1B19F3XH4052756
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



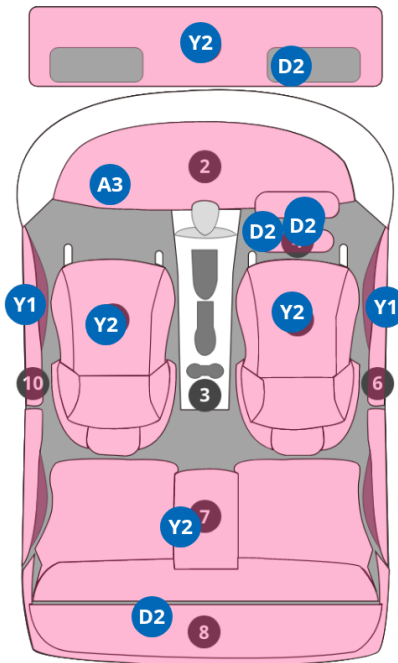
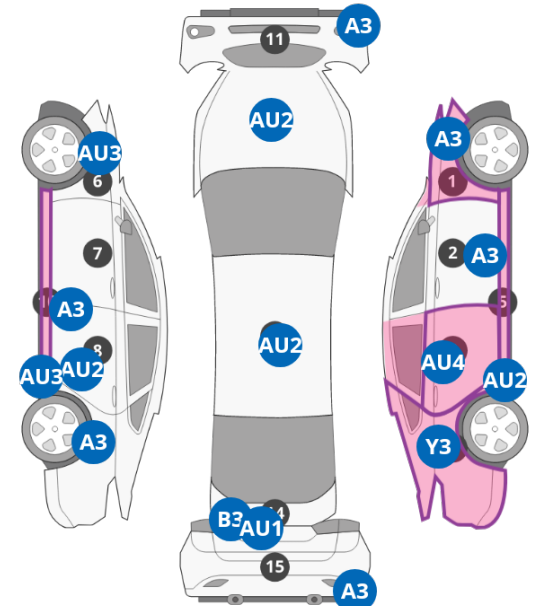
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	107	111	108
2	Boot Lid	130.6	132	134	126
3	Roof	113.0	114	111	119/108
4	Left Front Fender	116.3	107	116	126
5	Left Front Door	127.3	132	127	123
6	Center Panel Left				
7	Left Rear Door	123.3	123	126	121
8	Left Back Panel	131.6	138	126	131
9	Right Front Fender	217.0	415	122	114
10	Right Front Door	124.0	119	117	136
11	Center Panel Right				
12	Right Rear Door	288.6	453	254	159
13	Right Back Panel	218.3	176	171	308

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Mat Other - Worked - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Worked - Small / Trunk Room - Loose, Deformed - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Overall Exterior - Color Change - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Re-Paint Uneven - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Modified - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with jack, no spare tire and key, no tools, no warranty and manual booklet, issue on reverse camera, issue on side mirror, issue on foglamp switch, aircon issue, hands free steering switch issue, unusual noise at engine bay, idle issue, shorted issue, scratches and dent on exterior, scratches and yellowing headlight, scratches on taillight.