

General Information

Date & Time: 22, Jul, 2026 15:42

Make	Toyota	Model	Veloz
YOM	2025	Odo Meter Reading	20,696
Registration No.	NJA6241	Chassis No.	MHFAB1BY6S3133536
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



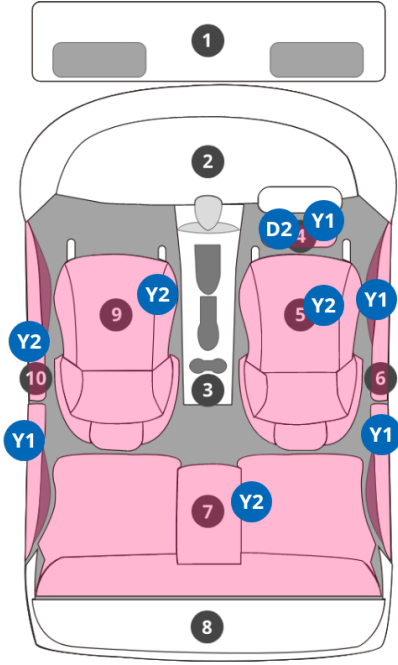
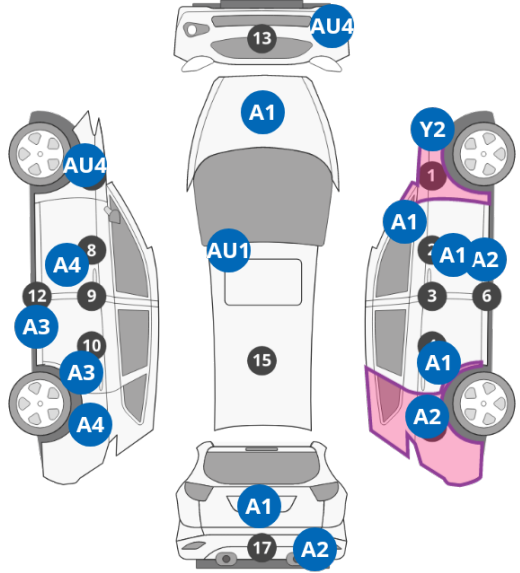
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	100	99	112
2	Boot Lid	100.6	96	114	92
3	Roof	120.7	116	126	104/137
4	Left Front Fender	107.3	105	105	112
5	Left Front Door	121.6	111	123	131
6	Center Panel Left				
7	Left Rear Door	116.3	122	113	114
8	Left Back Panel	121.6	120	127	118
9	Right Front Fender	186.0	195	182	181
10	Right Front Door	151.0	157	153	143
11	Center Panel Right				
12	Right Rear Door	79.0	81	73	84
13	Right Back Panel	151.0	138	153	162

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Crack, Gap - Small / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/no warranty booklet/incomplete tools no jack/with spare tire/front bumper partially missing/with spare key/hairline scratches on the body/passenger door handle issue