

General Information

Date & Time: 15, Jul, 2026 15:09

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	82,722
Registration No.	NET5252	Chassis No.	PA1B18F38M4141441
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



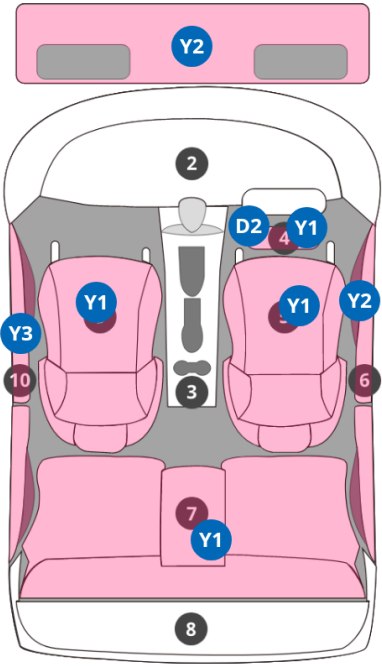
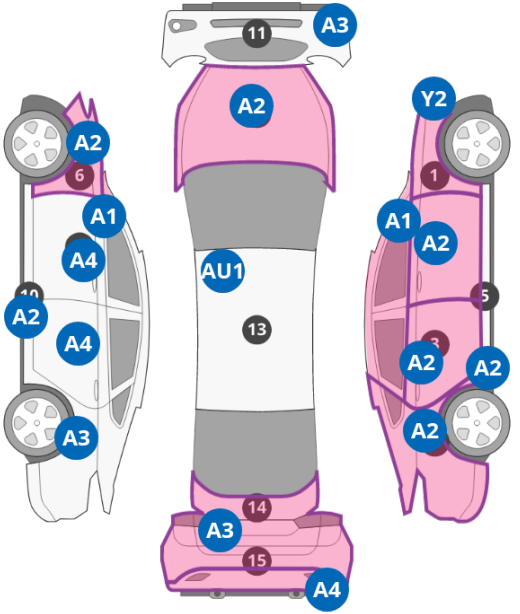
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	192.3	205	194	178
2	Boot Lid	151.0	171	135	147
3	Roof	97.6	110	94	95/91
4	Left Front Fender	943.3	1,241	457	1,132
5	Left Front Door	140.3	144	133	144
6	Center Panel Left				
7	Left Rear Door	129.3	139	123	126
8	Left Back Panel	109.6	110	108	111
9	Right Front Fender	623.0	309	442	1,118
10	Right Front Door	288.3	333	258	274
11	Center Panel Right				
12	Right Rear Door	242.0	227	223	276
13	Right Back Panel	182.3	152	167	228

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Crack, Gap - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Overall Exterior - Re-Paint Uneven - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/no remote key/wiper issue/reverse light issue/scratches on tailight and headlight cover/with seat cover/hairline scratches on the body