

General Information

Date & Time: 15, Jul, 2026 15:42

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	19,526
Registration No.	NHU6103	Chassis No.	PA1B18F33R4269268
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



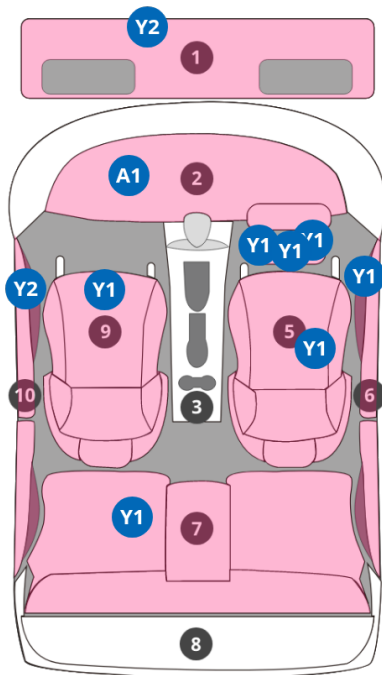
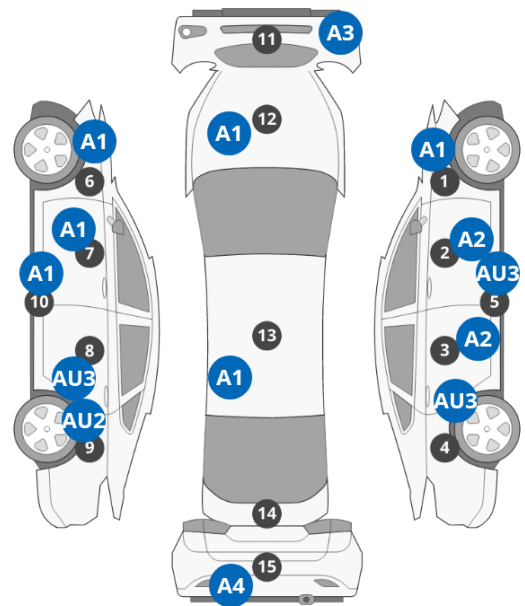
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.4	114	107	98
2	Boot Lid	120.6	111	129	122
3	Roof	103.2	110	98	110/95
4	Left Front Fender	102.3	106	102	99
5	Left Front Door	110.0	104	117	109
6	Center Panel Left				
7	Left Rear Door	107.6	110	103	110
8	Left Back Panel	115.6	122	105	120
9	Right Front Fender	104.9	107	100	108
10	Right Front Door	108.3	109	115	101
11	Center Panel Right				
12	Right Rear Door	106.3	106	106	107
13	Right Back Panel	113.3	106	110	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/without warranty booklet/without tools and jack/without spare key/with hairlines scratches on the body/with side signal light left and right issue/with power steering issue/battery weak