

General Information

Date & Time: 15, Jul, 2026 08:19

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	25,766
Registration No.	DBS1215	Chassis No.	PA1B18F36R4280801
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



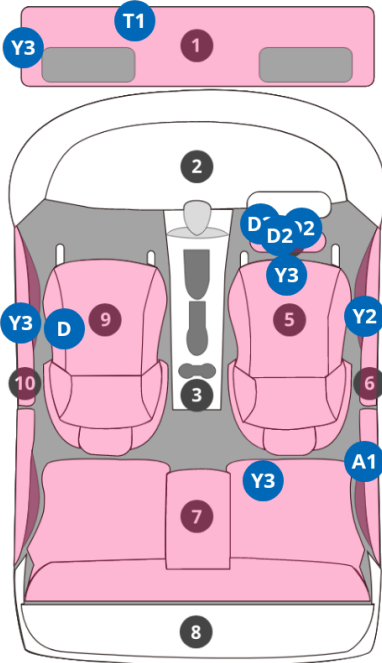
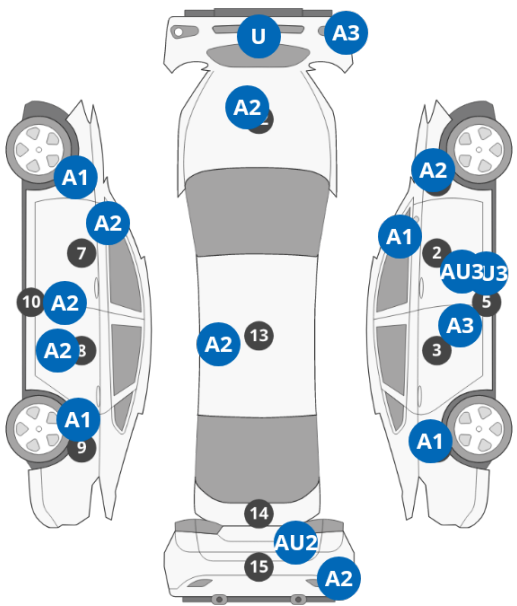
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	104	119	103
2	Boot Lid	114.0	111	111	120
3	Roof	97.8	100	95	93/104
4	Left Front Fender	93.9	100	90	92
5	Left Front Door	101.2	99	99	106
6	Center Panel Left				
7	Left Rear Door	97.2	98	94	100
8	Left Back Panel	102.0	108	102	96
9	Right Front Fender	107.0	97	98	126
10	Right Front Door	99.3	97	100	101
11	Center Panel Right				
12	Right Rear Door	101.0	102	100	101
13	Right Back Panel	121.6	116	102	147

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Cigarette Burns - Burnt Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, possible flooding,