

General Information

Date & Time: 20, Jul, 2026 15:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	42,535
Registration No.	DBP2569	Chassis No.	PA1B18F31R4258821
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



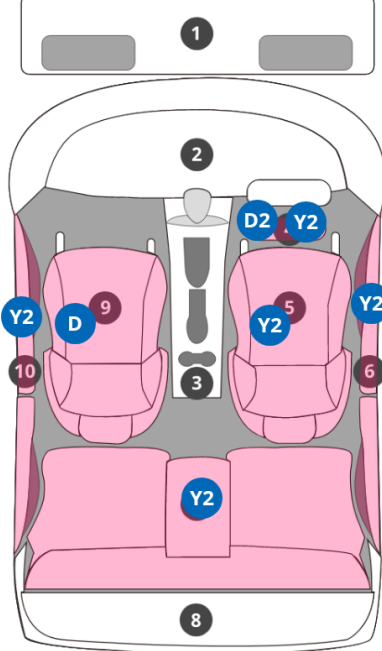
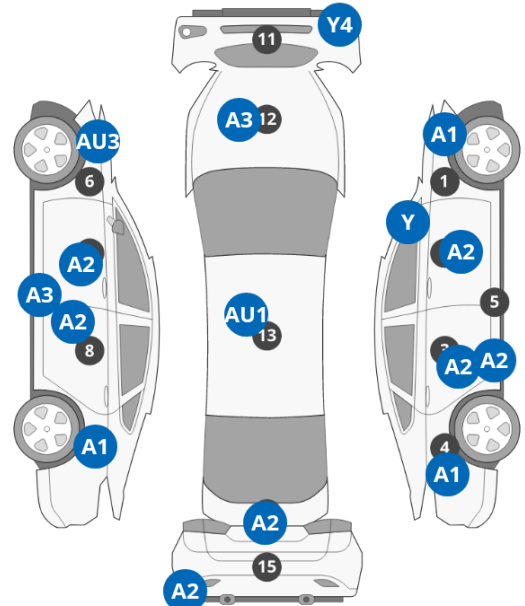
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	100	110	99
2	Boot Lid	110.6	108	108	116
3	Roof	96.0	99	96	93/97
4	Left Front Fender	105.6	115	103	99
5	Left Front Door	101.3	102	99	103
6	Center Panel Left				
7	Left Rear Door	104.9	111	109	95
8	Left Back Panel	112.3	116	111	110
9	Right Front Fender	99.8	94	100	106
10	Right Front Door	98.1	103	96	95
11	Center Panel Right				
12	Right Rear Door	103.0	99	100	110
13	Right Back Panel	108.0	101	101	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks Roof - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / (R) Mirror - Crack - Damaged / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/no tools and jack/with spare tire/no spare key/side mirror issue/tailight cover cracked/room light issue/engine cover and fender liner issue/hairline scratches on the body/fuel smell inside/with seat cover