

General Information

Date & Time: 14, Jul, 2026 15:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	39,185
Registration No.	NHU8120	Chassis No.	PA1B18F36R4272780
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



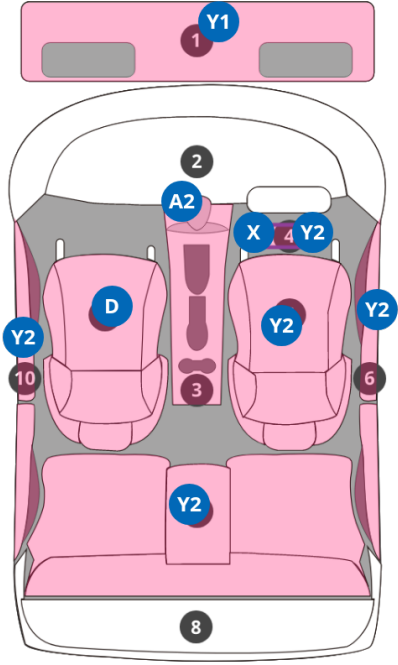
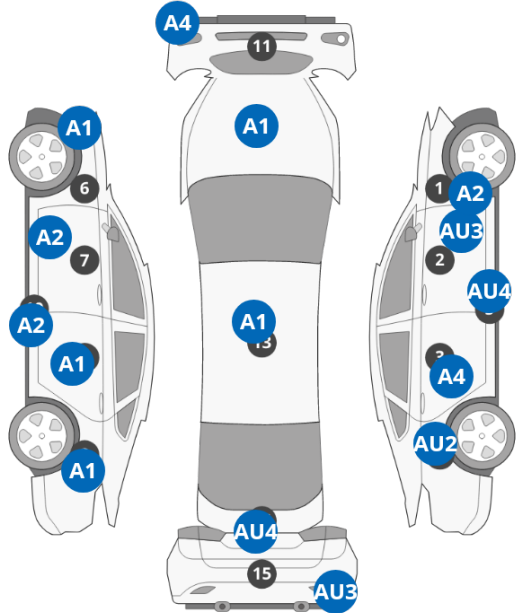
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	103	108	103
2	Boot Lid	115.3	108	119	119
3	Roof	106.5	114	105	103/104
4	Left Front Fender	103.6	111	100	100
5	Left Front Door	105.0	104	102	109
6	Center Panel Left				
7	Left Rear Door	111.0	121	105	107
8	Left Back Panel	114.3	119	115	109
9	Right Front Fender	101.5	98	98	109
10	Right Front Door	99.9	99	105	96
11	Center Panel Right				
12	Right Rear Door	107.0	106	108	107
13	Right Back Panel	109.3	107	105	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/rough idling/suspension issue/air damper issue/gap in trunk door/scratches on taillight cover/trunk door latch/hairline scratches on the body/with spare key/with seat cover