

General Information

Date & Time: 14, Jul, 2026 15:46

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	65,750
Registration No.	NEY8741	Chassis No.	PA1B18F36R4265442
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



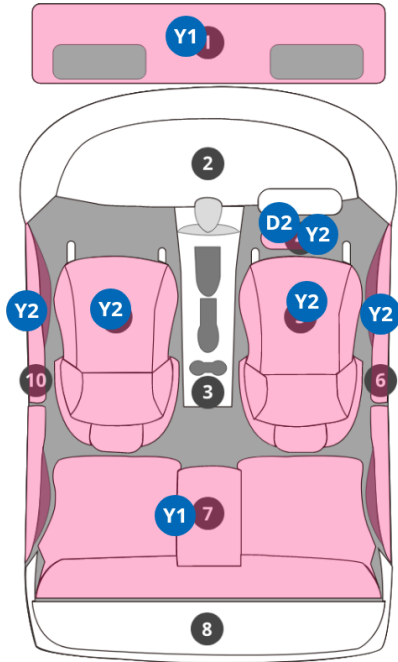
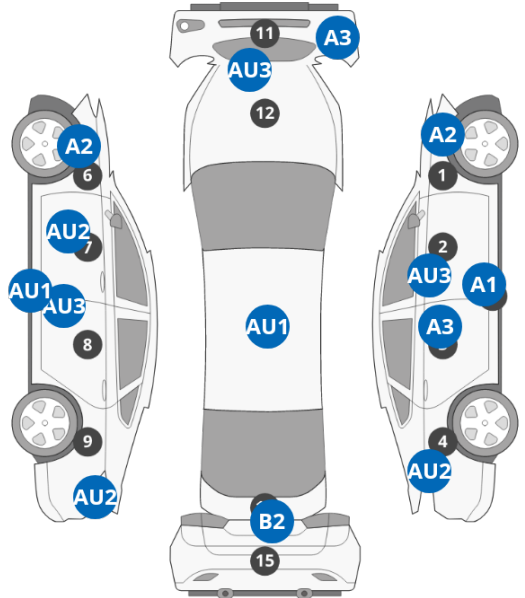
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	114	123	134
2	Boot Lid	126.0	125	123	130
3	Roof	120.5	130	117	115/120
4	Left Front Fender	110.3	111	106	114
5	Left Front Door	119.3	122	123	113
6	Center Panel Left				
7	Left Rear Door	115.6	116	114	117
8	Left Back Panel	114.6	120	113	111
9	Right Front Fender	115.6	124	110	113
10	Right Front Door	118.3	117	116	122
11	Center Panel Right				
12	Right Rear Door	113.6	126	107	108
13	Right Back Panel	123.6	141	112	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Modified - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with jack, with manual and warranty booklet, with reverse camera, no tools, scratches and dent on exterior, scratches on taillight and headlight, steering issue.