

General Information

Date & Time: 20, Jul, 2026 15:40

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	29,378
Registration No.	NJF2506	Chassis No.	PA1B18F32R4270024
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



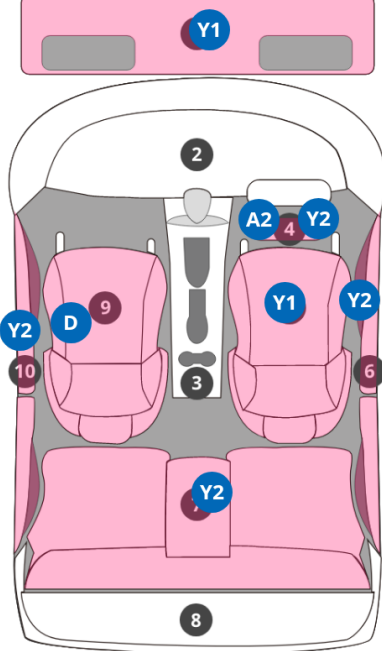
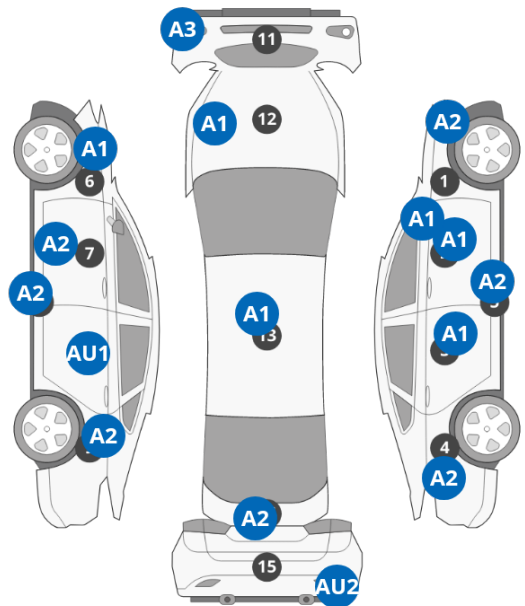
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	102	112	115
2	Boot Lid	122.0	123	122	121
3	Roof	102.3	114	90	105/100
4	Left Front Fender	104.6	110	101	103
5	Left Front Door	105.6	102	101	114
6	Center Panel Left				
7	Left Rear Door	114.0	120	113	109
8	Left Back Panel	121.3	130	119	115
9	Right Front Fender	104.3	100	106	107
10	Right Front Door	101.6	100	105	100
11	Center Panel Right				
12	Right Rear Door	107.3	105	105	112
13	Right Back Panel	120.6	123	112	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal	Remarks (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/no spare tire/with spare key/with seat cover/hairline scratches on the body/air vent issue