

General Information

Date & Time: 03, Mar, 2025 16:42

Make	Toyota	Model	Wigo
YOM	2022	Mileage	49,548
Registration No.	NFJ5643	Chassis No.	MHKA4DF5FNJ066874
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Orange		

Body / Panel Condition



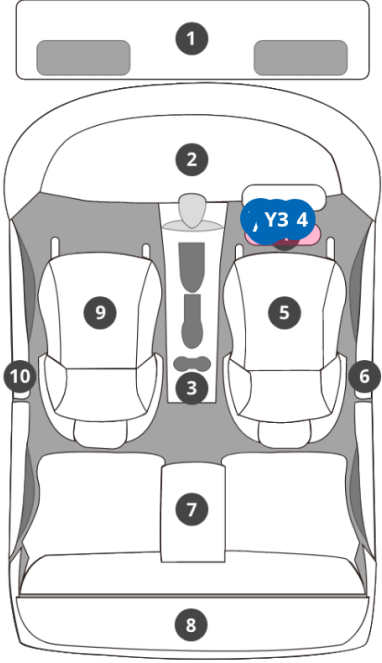
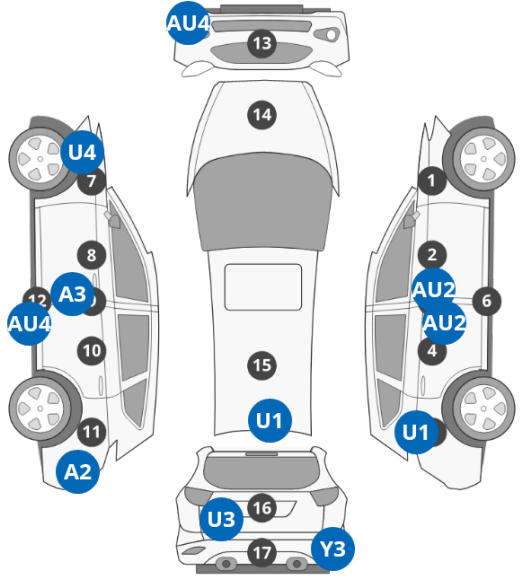
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.3	98	99	89
2	Boot Lid	371.0	127	852	134
3	Roof	80.7	76	86	78/83
4	Left Front Fender	104.7	96	108	110
5	Left Front Door	97.5	101	97	95
6	Center Panel Left				
7	Left Rear Door	105.3	107	103	106
8	Left Back Panel	106.0	117	105	96
9	Right Front Fender	93.9	89	100	93
10	Right Front Door	86.2	85	89	85
11	Center Panel Right				
12	Right Rear Door	90.7	90	93	90
13	Right Back Panel	96.8	96	92	102

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Cut, Crack - Small / Mat Other - Grime - Medium	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Fender, Molding - Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ with LTO plate/ with jack and spare tire and tools/ bent rear door latch/