

General Information

Date & Time: 15, Jul, 2026 07:42

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	48,143
Registration No.	NHU3581	Chassis No.	PA1B18F31R4271360
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



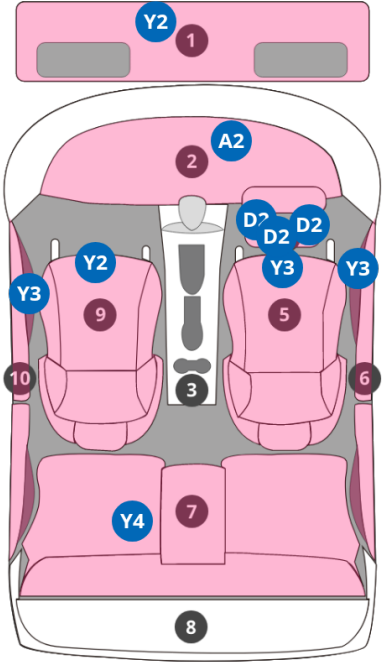
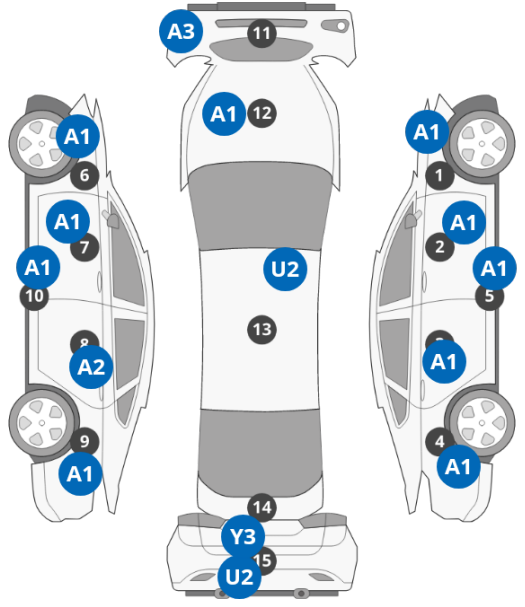
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	122	116	110
2	Boot Lid	130.6	127	131	134
3	Roof	112.5	119	105	117/109
4	Left Front Fender	109.3	106	112	110
5	Left Front Door	111.6	108	109	118
6	Center Panel Left				
7	Left Rear Door	118.0	130	115	109
8	Left Back Panel	119.0	127	115	115
9	Right Front Fender	113.0	114	115	110
10	Right Front Door	110.6	113	110	109
11	Center Panel Right				
12	Right Rear Door	115.3	109	115	122
13	Right Back Panel	119.0	109	110	138

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with jack no tools/with hairlines scratches on the body/with spare tire/with reverse camera/without spare tire