

General Information

Date & Time: 03, Mar, 2025 13:30

Make	Toyota	Model	Vios
YOM	2024	Mileage	25,945
Registration No.	NHM8721	Chassis No.	PA1B18F38R4246066
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



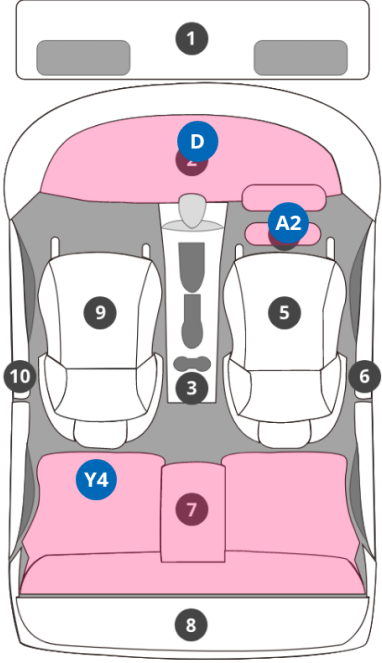
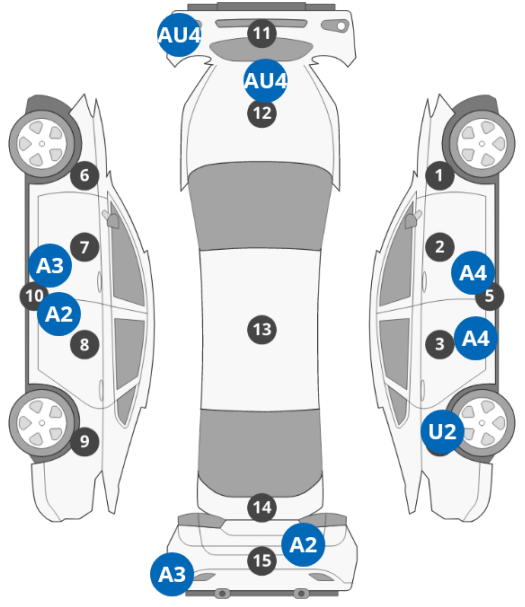
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	185.6	198	182	177
2	Boot Lid	139.3	135	130	153
3	Roof	154.0	155	174	145/142
4	Left Front Fender	151.0	146	153	154
5	Left Front Door	149.6	155	148	146
6	Center Panel Left				
7	Left Rear Door	149.0	160	147	140
8	Left Back Panel	154.6	173	149	142
9	Right Front Fender	169.0	181	162	164
10	Right Front Door	118.6	130	117	109
11	Center Panel Right				
12	Right Rear Door	134.0	129	127	146
13	Right Back Panel	147.0	148	136	157

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Large	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklets/ left tail light and headlights damages