

General Information

Date & Time: 15, Jul, 2026 08:41

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	36,522
Registration No.	ZAF5950	Chassis No.	MHKAA1BC0RJ034418
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red Mica Metallic		

Body / Panel Condition



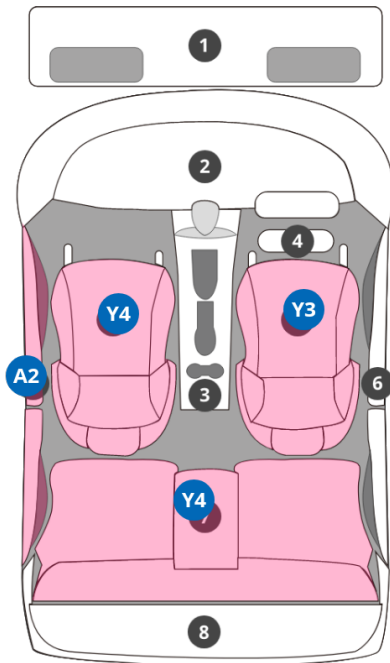
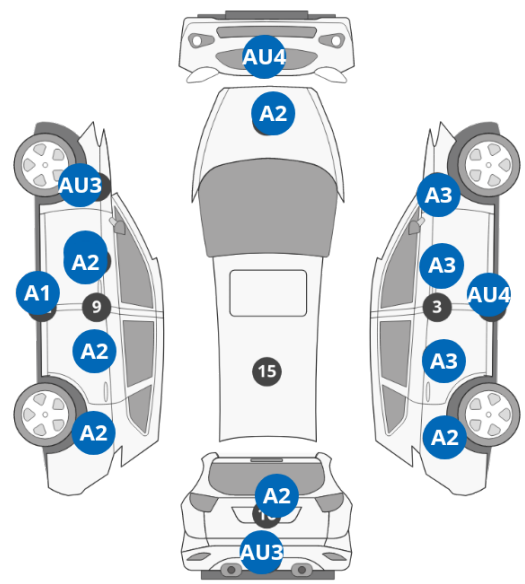
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	137.6	132	132	149
2	Boot Lid	111.6	116	106	113
3	Roof	119.7	122	118	126/113
4	Left Front Fender	109.0	110	113	104
5	Left Front Door	117.6	117	117	119
6	Center Panel Left				
7	Left Rear Door	117.0	124	117	110
8	Left Back Panel	107.0	104	110	107
9	Right Front Fender	103.0	99	104	106
10	Right Front Door	118.0	115	116	123
11	Center Panel Right				
12	Right Rear Door	115.3	110	118	118
13	Right Back Panel	107.0	106	104	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, no seat cover, with spare key 1pc, with spare tire, with hairline scratches.