

General Information

Date & Time: 14, Jul, 2026 20:13

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	27,574
Registration No.	KAU8710	Chassis No.	PA1B18F34S4291740
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



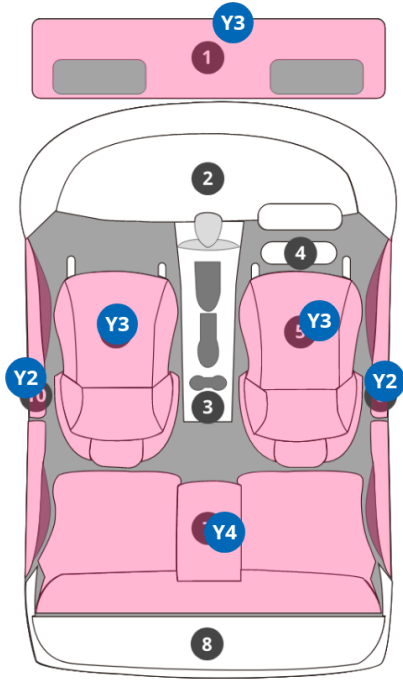
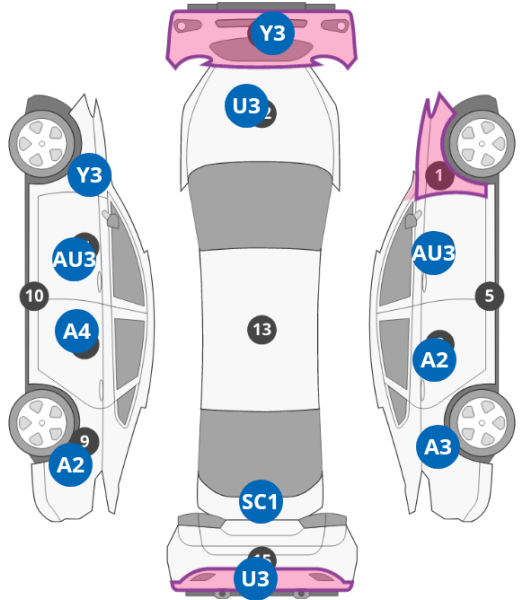
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	115	127	124
2	Boot Lid	112.0	108	114	114
3	Roof	111.7	116	119	107/105
4	Left Front Fender	121.0	117	130	116
5	Left Front Door	113.3	114	113	113
6	Center Panel Left				
7	Left Rear Door	125.0	126	127	122
8	Left Back Panel	128.6	147	121	118
9	Right Front Fender	144.0	120	141	171
10	Right Front Door	110.0	118	105	107
11	Center Panel Right				
12	Right Rear Door	107.6	102	107	114
13	Right Back Panel	108.0	111	101	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Dent - Medium / Trunk Hood, Rear Gate - Rust, Corrosion - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, no seat cover, with spare tire, with spare key 2pcs, with hairline scratches, with areas which are repaired (difference in color).