

General Information

Date & Time: 15, Jul, 2026 08:42

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	40,963
Registration No.	JAS8234	Chassis No.	PA1B18F34R4274575
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



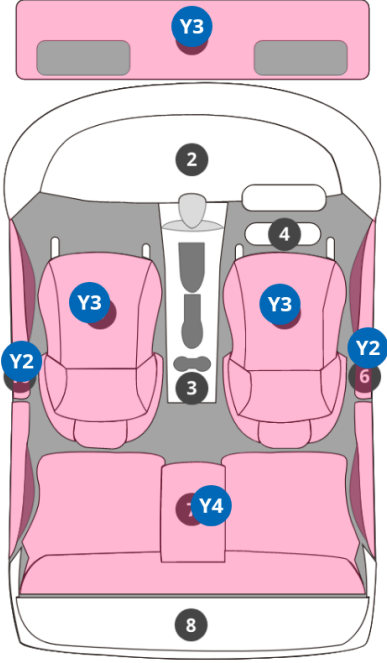
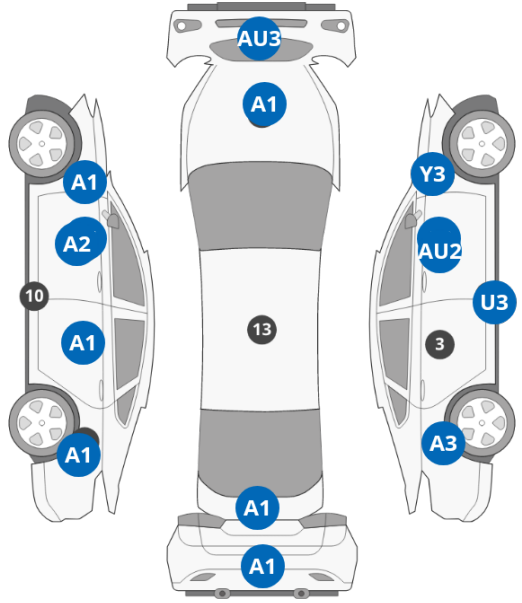
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	112	117	114
2	Boot Lid	109.0	107	106	114
3	Roof	108.5	106	112	105/111
4	Left Front Fender	98.0	95	100	100
5	Left Front Door	105.0	108	101	106
6	Center Panel Left				
7	Left Rear Door	100.3	106	98	97
8	Left Back Panel	105.6	104	105	108
9	Right Front Fender	105.3	106	104	106
10	Right Front Door	99.3	100	96	102
11	Center Panel Right				
12	Right Rear Door	120.0	110	115	135
13	Right Back Panel	119.6	125	115	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, with spare tire, with spare key 2pcs, no seat cover, with hairline scratches, weak battery, with areas that are modified with sticker.