

General Information

Date & Time: 15, Jul, 2026 08:39

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	35,475
Registration No.	LAQ2026	Chassis No.	PA1B18F36R4275372
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



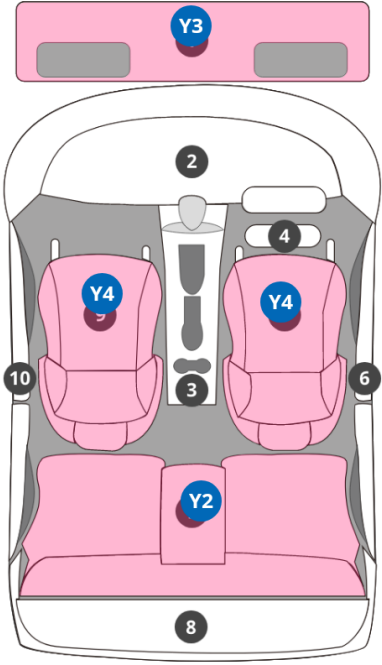
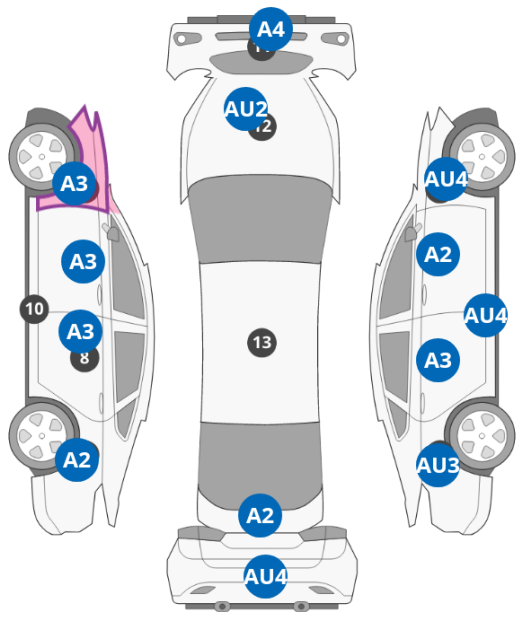
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	109	111	112
2	Boot Lid	103.9	99	107	106
3	Roof	101.2	104	101	92/108
4	Left Front Fender	95.7	100	95	93
5	Left Front Door	106.1	95	103	120
6	Center Panel Left				
7	Left Rear Door	102.6	95	108	105
8	Left Back Panel	109.0	120	104	103
9	Right Front Fender	101.3	96	101	107
10	Right Front Door	99.3	103	95	100
11	Center Panel Right				
12	Right Rear Door	100.0	101	100	99
13	Right Back Panel	108.3	105	102	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Rear Seat - Grime - Small / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Front Wheel, Cover - Cap Missing - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, no warranty booklet, with tools, with jack, with seat cover, with spare tire, no spare key, with hairline scratches, weak battery.