

General Information

Date & Time: 14, Jul, 2026 20:24

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	15,232
Registration No.	ZAF8898	Chassis No.	PA1B18F35S4300526
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



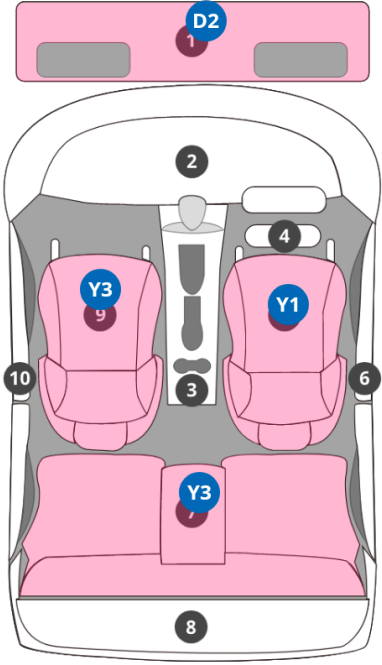
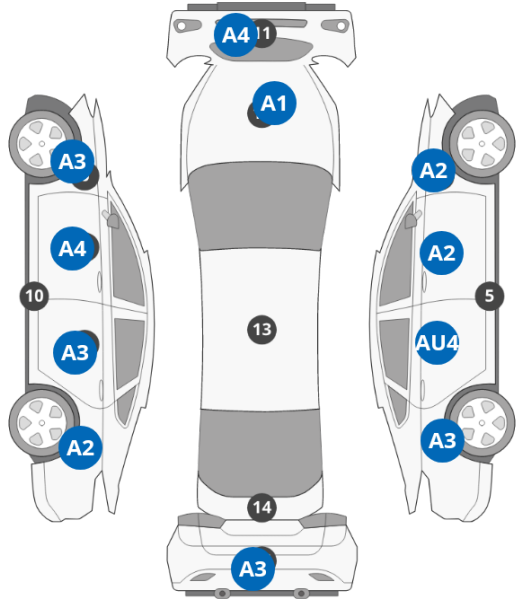
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	63	120	120
2	Boot Lid	114.6	116	111	117
3	Roof	113.2	111	118	100/124
4	Left Front Fender	111.3	105	111	118
5	Left Front Door	110.6	111	113	108
6	Center Panel Left				
7	Left Rear Door	107.3	112	107	103
8	Left Back Panel	115.6	117	115	115
9	Right Front Fender	112.0	115	112	109
10	Right Front Door	112.3	113	110	114
11	Center Panel Right				
12	Right Rear Door	113.6	108	114	119
13	Right Back Panel	117.6	112	115	126

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium / Ceiling - Crinkle - Small / (L) Front Seat - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate, with warranty booklet, with tools, with jack, no seat cover, with spare key 2pcs, with spare tire, with hairline scratches.