

General Information

Date & Time: 14, Jul, 2026 15:47

Make	Suzuki	Model	Ertiga
YOM	2024	Odo Meter Reading	34
Registration No.	DNV3609	Chassis No.	MHYNC32SXRJ104611
CC	1.5	Transmission	A/T
Fuel Type	Hybrid	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



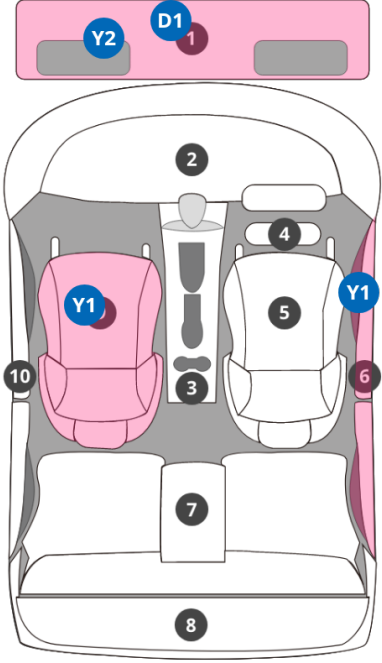
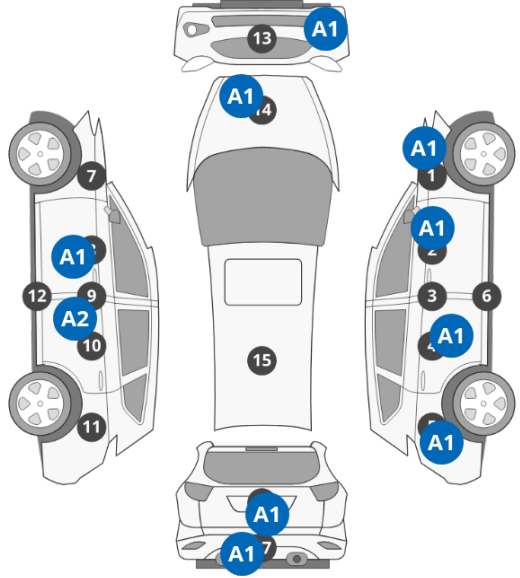
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.7	110	93	111
2	Boot Lid	94.0	94	88	100
3	Roof	107.2	108	117	104/100
4	Left Front Fender	99.6	98	99	102
5	Left Front Door	104.0	107	101	104
6	Center Panel Left				
7	Left Rear Door	110.6	119	109	104
8	Left Back Panel	100.8	103	104	95
9	Right Front Fender	88.7	90	86	90
10	Right Front Door	101.5	101	100	104
11	Center Panel Right				
12	Right Rear Door	101.4	100	99	105
13	Right Back Panel	93.4	96	93	92

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / Ceiling - Crinkle - Minimal / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Trim - Grime - Minimal	Remarks Overall Exterior - Faded(Color, Gloss) - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate, with spare tire and key, with warranty and manual booklet, with reverse camera, with jack and tools, minor scratches on exterior, slight fade paint, minor scratches on taillight and headlight.