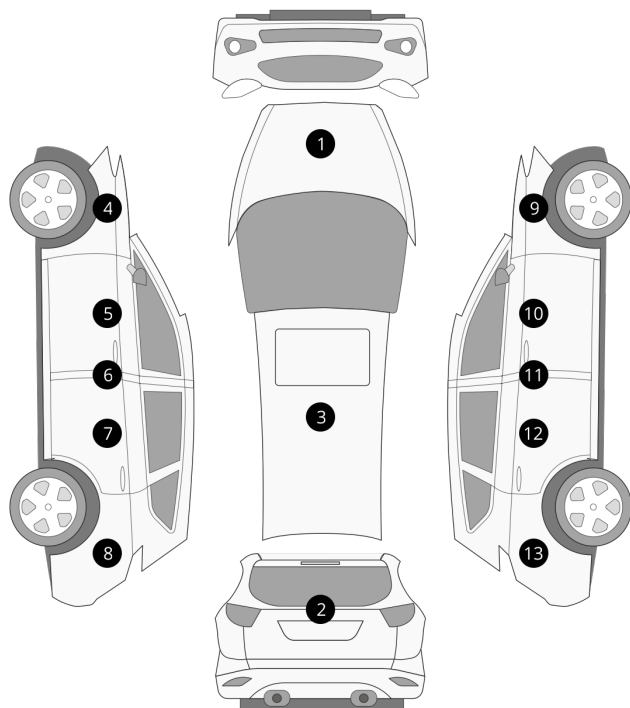


General Information

Date & Time: 22, Jul, 2026 15:41

Make	Nissan	Model	NV350
YOM	2025	Odo Meter Reading	10,979
Registration No.	GB07939	Chassis No.	JN1LC4E26Z0060237
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



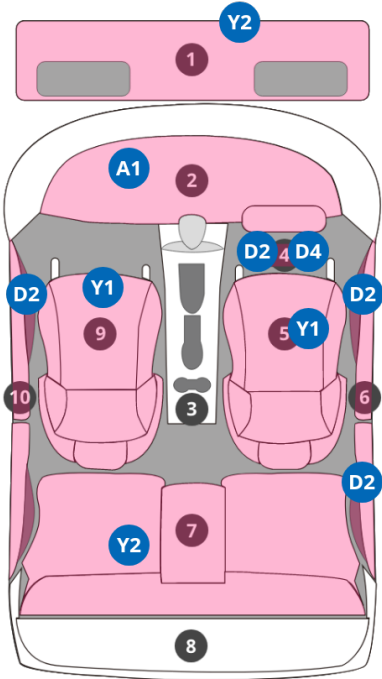
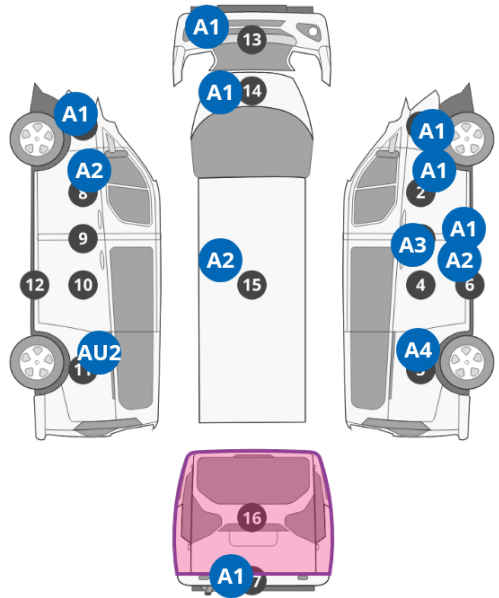
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.2	109	108	99
2	Boot Lid	90.7	88	91	93
3	Roof	103.6	102	116	98/99
4	Left Front Fender	98.6	101	94	101
5	Left Front Door	105.3	109	103	104
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	108.6	111	107	108
9	Right Front Fender	105.6	100	111	106
10	Right Front Door	102.3	97	96	114
11	Center Panel Right	102.2	110	100	97
12	Right Rear Door	109.6	103	120	106
13	Right Back Panel	107.3	110	106	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Mat Other - Worked - Large / Rear Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Front Panel - Scratch - Minimal / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with Ito plate/with warranty booklet/with jack and tools/with spare tire/with spare key/with dent and hairlines scratches on the body/with stain on the exterior/without reverse camera/possible flooding