

General Information

Date & Time: 04, Mar, 2025 18:29

Make	Toyota	Model	Vios
YOM	2020	Mileage	32,030
Registration No.	EAE9763	Chassis No.	PA1B18F31L4119974
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



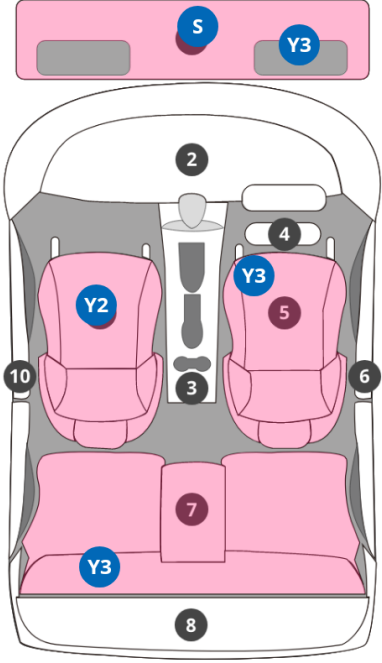
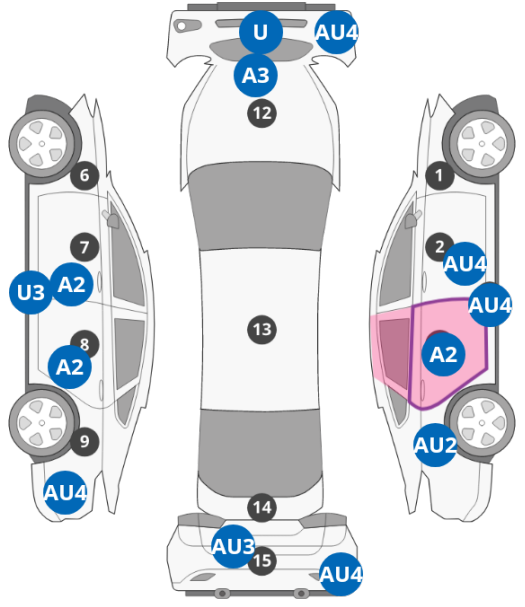
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	142.3	142	146	139
2	Boot Lid	118.6	113	117	126
3	Roof	90.2	79	96	94/93
4	Left Front Fender	92.4	96	93	89
5	Left Front Door	94.2	97	94	92
6	Center Panel Left				
7	Left Rear Door	95.4	98	97	92
8	Left Back Panel	107.6	117	106	100
9	Right Front Fender	223.6	226	230	215
10	Right Front Door	137.6	137	136	140
11	Center Panel Right				
12	Right Rear Door	149.3	140	140	168
13	Right Back Panel	152.6	151	155	152

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Sunvisor, Sunglass Holder - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Dent - Medium / (L) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : E
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
front right and rear left door cannot open properly. cannot confirm if it has spare tire and tools due of trunk door cannot open. without warranty booklet and jack. with LTO plate. indoor lights issue. shift knob missing. possible flooding. muddy headlight.