

General Information

Date & Time: 23, Jul, 2026 15:28

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	77,771
Registration No.	NKS5352	Chassis No.	PAHACACAXS6425978
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



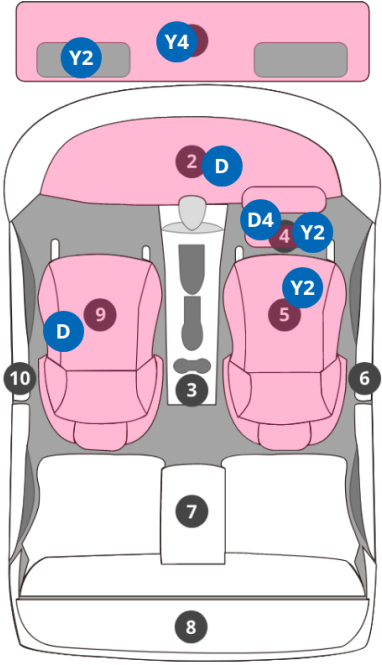
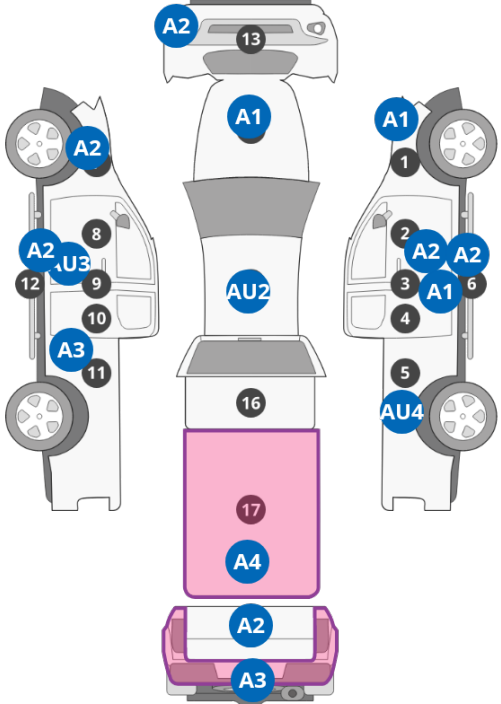
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	102	112	95
2	Boot Lid	52.7	57	49	53
3	Roof	115.7	122	119	117/105
4	Left Front Fender	109.3	106	114	108
5	Left Front Door	107.3	106	111	105
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	71.8	75	76	64
9	Right Front Fender	104.3	104	109	100
10	Right Front Door	108.0	102	109	113
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	63.1	57	71	61

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Worn - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks Cargo Bed Floor - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch - Large / (R) Side Gate - Scratch & Dent - Large / (R) Center Panel - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/no tools with jack/with spare tire/fuel filter replacement lamp on/tailight issue/seat belt issue/no spare key/scratches on side windows/rear room light issue/hairline scratches on the body