

General Information

Date & Time: 22, Jul, 2026 15:47

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	31,471
Registration No.	NEZ8414	Chassis No.	PAHACACA4S6427192
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



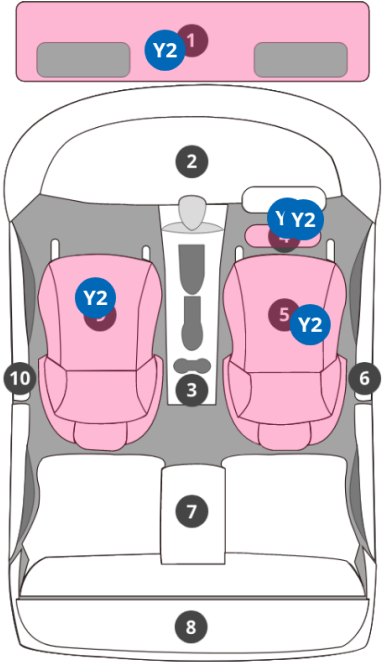
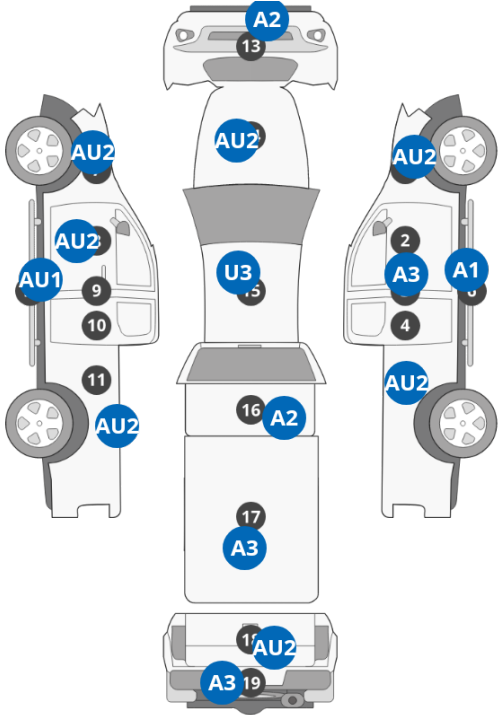
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.8	109	11	111
2	Boot Lid	74.4	76	68	79
3	Roof	134.2	160	132	129/116
4	Left Front Fender	110.0	109	114	107
5	Left Front Door	109.6	109	111	109
6	Center Panel Left	114.0	158	90	95
7	Left Rear Door				
8	Left Back Panel	76.1	78	76	74
9	Right Front Fender	112.6	110	119	109
10	Right Front Door	114.0	115	113	114
11	Center Panel Right	119.0	118	120	119
12	Right Rear Door				
13	Right Back Panel	79.3	81	74	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (R) Side Gate - Scratch & Dent - Small / Roof - Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Medium / Cab Back Panel - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate, with spare tire and key, with jack, with manual and warranty booklet, no reverse camera, scratches and dent on exterior, scratches in taillight and headlight.