

General Information

Date & Time: 22, Jul, 2026 07:39

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	15,245
Registration No.	NJQ5783	Chassis No.	PAHACACA5S6426665
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



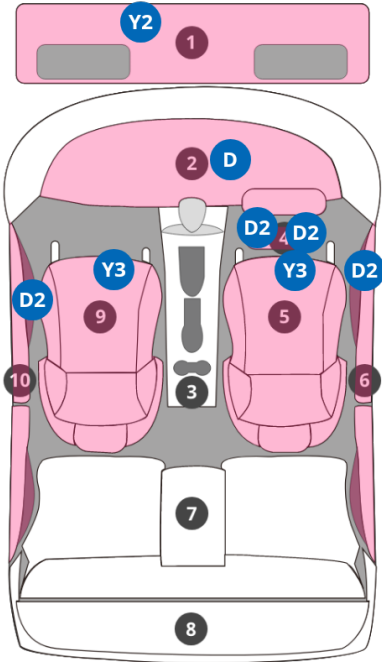
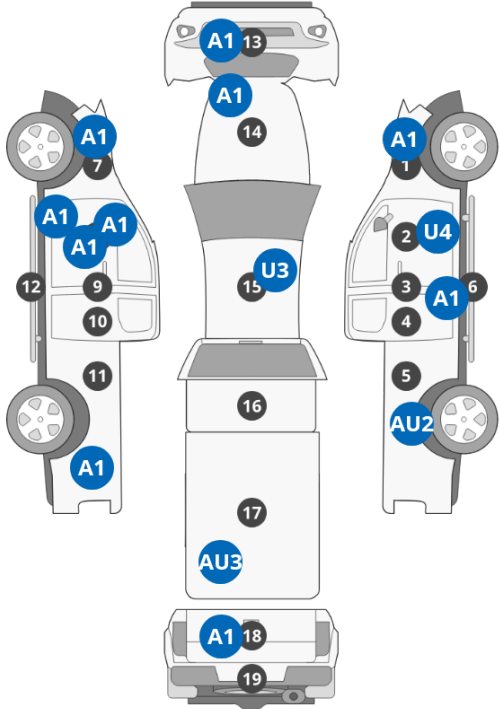
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	109	113	94
2	Boot Lid	74.2	79	62	82
3	Roof	115.2	125	117	113/106
4	Left Front Fender	113.0	112	110	117
5	Left Front Door	105.6	106	104	107
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	90.1	81	100	90
9	Right Front Fender	114.0	122	111	109
10	Right Front Door	107.0	105	106	110
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	82.7	90	82	77

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Small / Cargo Bed Floor - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with spare tire/without spare key/without warranty booklet/with dent and hairlines scratches on the body/with jack no tools/without reverse camera