

General Information

Date & Time: 22, Jul, 2026 07:41

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	21,366
Registration No.	DCA8144	Chassis No.	PAHAD9DA2S1627611
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	Silver		

Body / Panel Condition



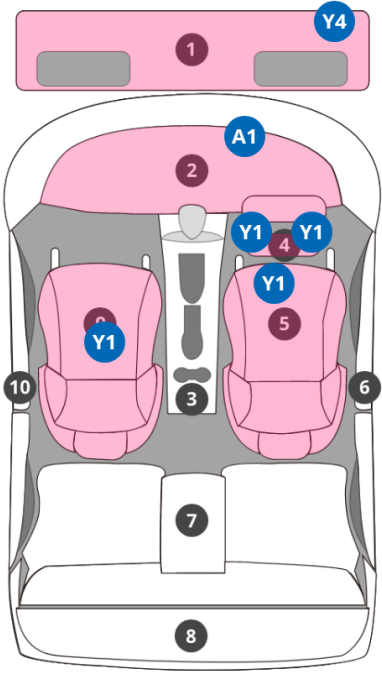
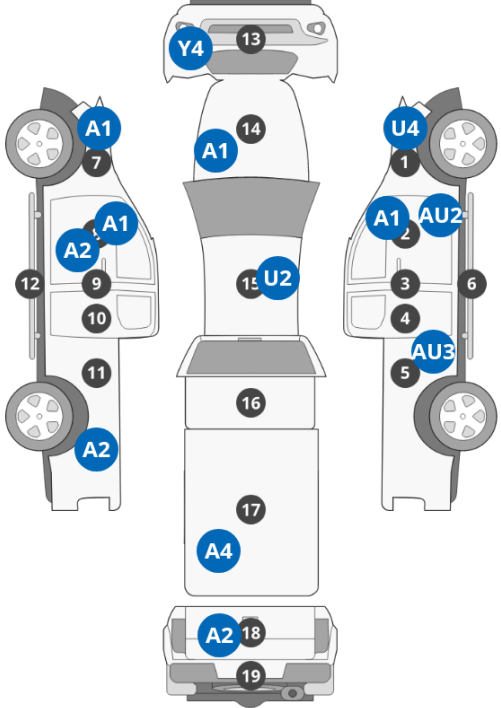
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.2	102	102	91
2	Boot Lid	102.5	106	88	114
3	Roof	108.2	115	111	104/103
4	Left Front Fender	108.3	102	112	111
5	Left Front Door	106.3	110	110	99
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	94.5	95	92	96
9	Right Front Fender	109.0	112	110	105
10	Right Front Door	106.3	101	109	109
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	125.3	105	131	140

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Dent - Large / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Medium / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with spare tire/with warranty booklet/with tools and jack/with dent and hairlines scratches on the body/without spare key/without reverse camera