

General Information

Date & Time: 04, Mar, 2025 15:40

Make	Toyota	Model	Vios
YOM	2021	Mileage	65,949
Registration No.	NEM5189	Chassis No.	PA1B18F3XM4156605
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



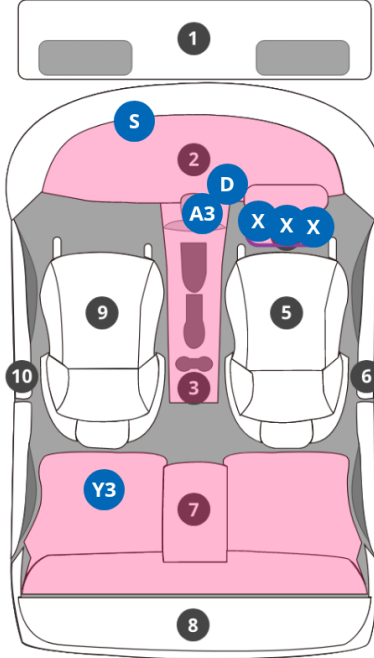
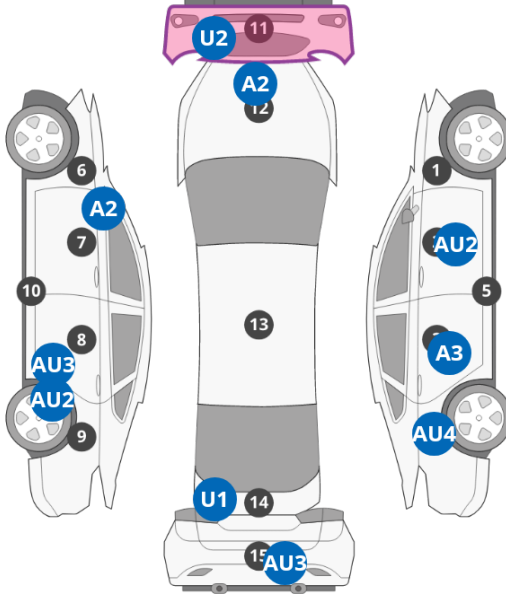
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	107	101	111
2	Boot Lid	97.0	98	90	103
3	Roof	91.1	100	81	88/96
4	Left Front Fender	92.7	94	94	90
5	Left Front Door	90.5	90	95	87
6	Center Panel Left				
7	Left Rear Door	90.5	92	90	89
8	Left Back Panel	104.6	104	109	101
9	Right Front Fender	89.8	87	92	90
10	Right Front Door	93.0	91	91	97
11	Center Panel Right				
12	Right Rear Door	97.4	97	97	99
13	Right Back Panel	109.9	98	128	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet and jack. without spare tire and tools. ,missing trunk floor. with LTO plate.