

General Information

Date & Time: 20, Jul, 2026 14:44

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	12,502
Registration No.	CCD5584	Chassis No.	PA1B18F3XP4218797
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



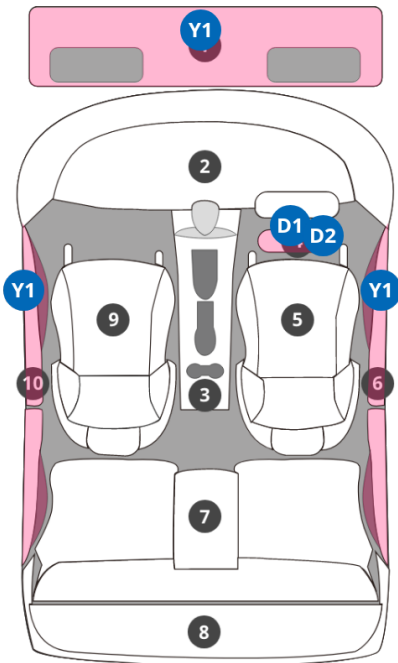
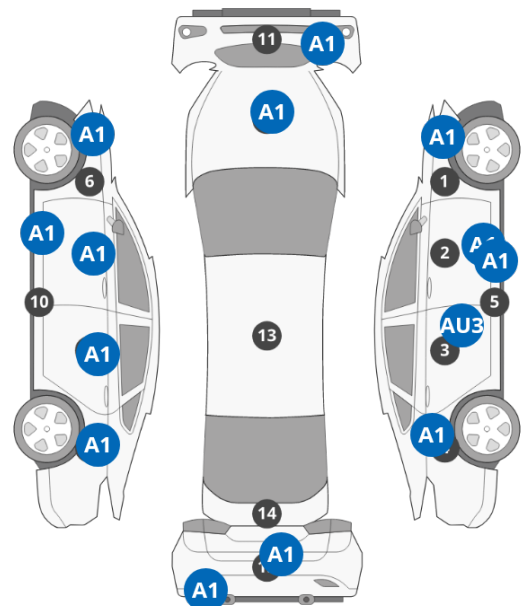
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	287.6	318	258	287
2	Boot Lid	115.3	113	112	121
3	Roof	199.2	199	183	221/194
4	Left Front Fender	176.6	138	234	158
5	Left Front Door	101.8	101	99	106
6	Center Panel Left				
7	Left Rear Door	109.3	115	107	106
8	Left Back Panel	113.6	112	111	118
9	Right Front Fender	107.3	111	105	106
10	Right Front Door	108.0	112	103	109
11	Center Panel Right				
12	Right Rear Door	105.3	103	100	113
13	Right Back Panel	104.0	96	98	118

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Floor Mat - Worked - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 3keys, no warranty booklet and tools, scratches on headlights and taillights,visible hairlines scratches on vehicle