

General Information

Date & Time: 22, Jul, 2026 15:43

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	22,324
Registration No.	NKO4790	Chassis No.	PA2JA8EM6S0154484
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



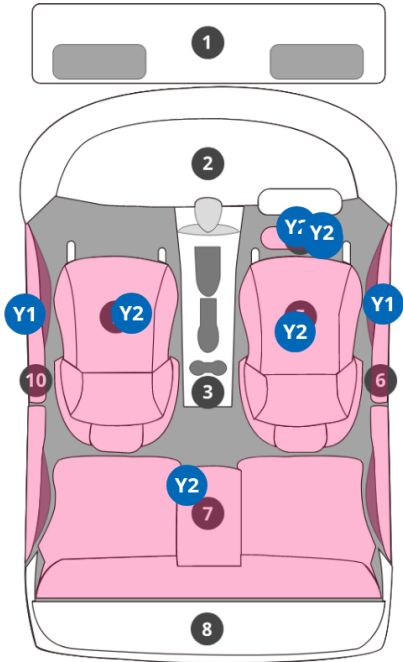
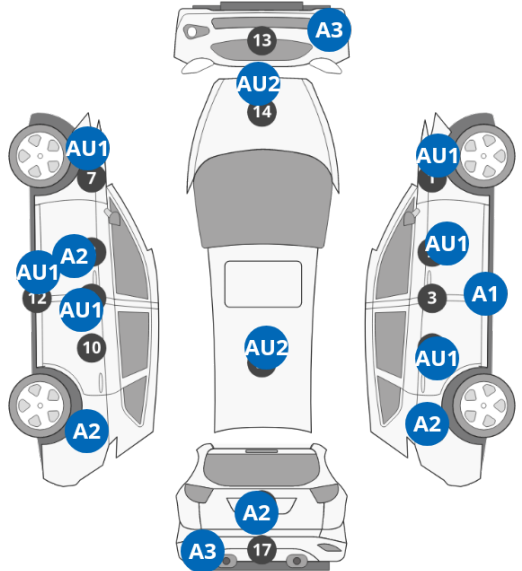
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	113	129	109
2	Boot Lid	118.0	115	119	120
3	Roof	109.2	113	103	107/114
4	Left Front Fender	106.0	105	108	105
5	Left Front Door	114.6	107	122	115
6	Center Panel Left				
7	Left Rear Door	107.0	105	115	101
8	Left Back Panel	120.3	123	124	114
9	Right Front Fender	108.6	111	110	105
10	Right Front Door	114.0	117	113	112
11	Center Panel Right				
12	Right Rear Door	116.3	114	114	121
13	Right Back Panel	116.3	112	119	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Mat Other - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate, with spare tire and key, with jack and tools, with manual and warranty booklet, with reverse camera, scratches and dent on exterior, scratches in taillight and headlight.