

General Information

Date & Time: 20, Jul, 2026 15:18

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	53,440
Registration No.	NKG4910	Chassis No.	PA1B18F35R4275315
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



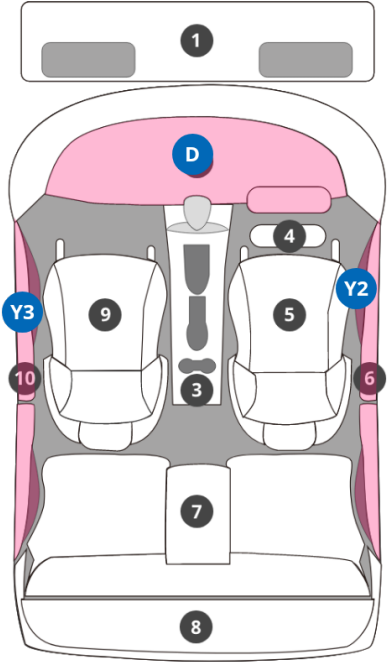
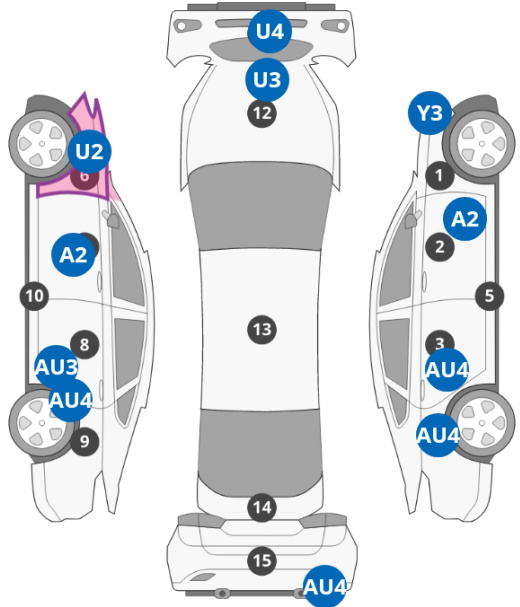
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	100	104	113
2	Boot Lid	102.3	101	98	108
3	Roof	99.8	98	98	107/97
4	Left Front Fender	159.6	289	99	91
5	Left Front Door	103.2	100	97	113
6	Center Panel Left				
7	Left Rear Door	97.1	100	96	96
8	Left Back Panel	101.8	108	96	102
9	Right Front Fender	101.1	100	98	106
10	Right Front Door	100.2	101	99	101
11	Center Panel Right				
12	Right Rear Door	102.1	94	97	115
13	Right Back Panel	102.3	100	109	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Dent - Large / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Dent - Small / (L) Front Fender, Molding - Repair mark - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
interior lights issue/ light scratches around the exterior/ with jack and spare tire/ with LTO plate and warranty booklet/ with tools