

General Information

Date & Time: 20, Jul, 2026 15:44

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	13,637
Registration No.	NJK3207	Chassis No.	PA1B18F31S4299441
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



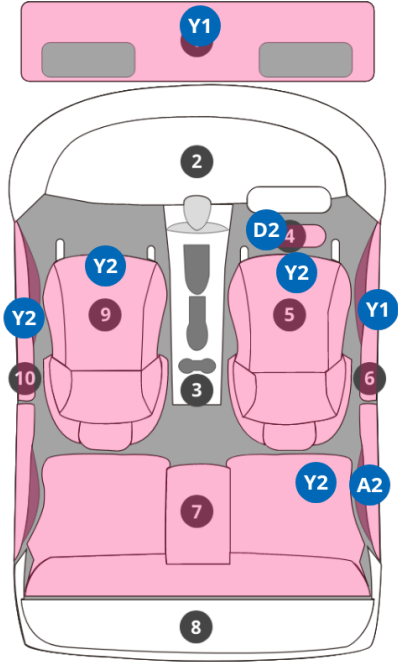
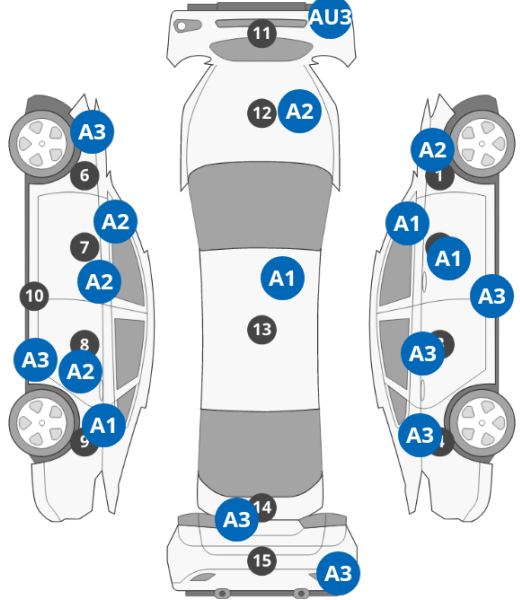
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	127	121	127
2	Boot Lid	116.6	109	112	129
3	Roof	109.7	117	108	107/107
4	Left Front Fender	111.3	109	111	114
5	Left Front Door	106.3	113	104	102
6	Center Panel Left				
7	Left Rear Door	114.3	114	117	112
8	Left Back Panel	128.6	121	149	116
9	Right Front Fender	119.3	122	118	118
10	Right Front Door	115.6	124	108	115
11	Center Panel Right				
12	Right Rear Door	110.0	107	109	114
13	Right Back Panel	112.6	111	110	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Cut, Crack - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratches on headlight and tail light, cracked headlight