

General Information

Date & Time: 20, Jul, 2026 14:38

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	12,717
Registration No.	NJK8277	Chassis No.	PA1B18F37S4302133
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



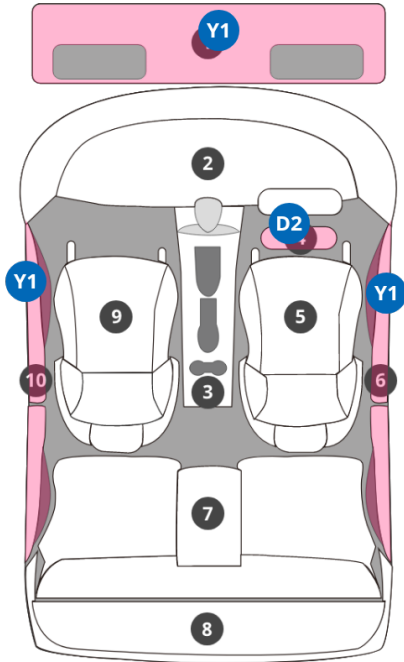
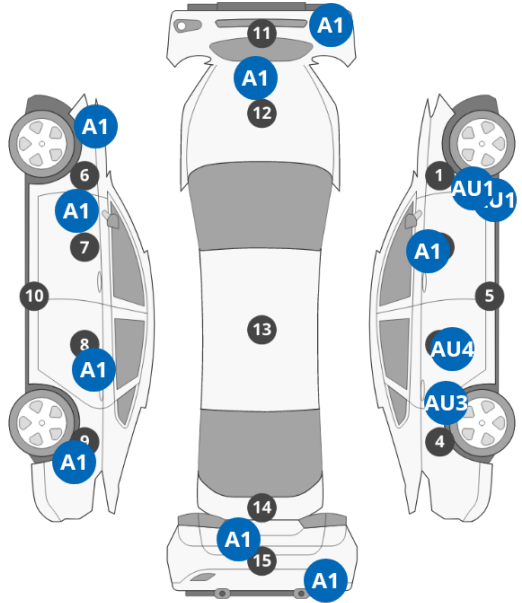
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	112	115	121
2	Boot Lid	124.3	133	117	123
3	Roof	101.8	107	97	104/100
4	Left Front Fender	110.3	109	111	111
5	Left Front Door	107.3	115	105	102
6	Center Panel Left				
7	Left Rear Door	109.6	109	110	110
8	Left Back Panel	114.6	120	113	111
9	Right Front Fender	108.6	110	106	110
10	Right Front Door	104.6	104	103	107
11	Center Panel Right				
12	Right Rear Door	105.9	100	107	111
13	Right Back Panel	111.6	107	106	122

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal	Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet, 2keys, no tools, scratches on headlights and taillights