

General Information

Date & Time: 17, Jul, 2026 16:18

Make	Toyota	Model	Avanza
YOM	2026	Odo Meter Reading	36,817
Registration No.	CDD3523	Chassis No.	MHFAA1BY5S0053939
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



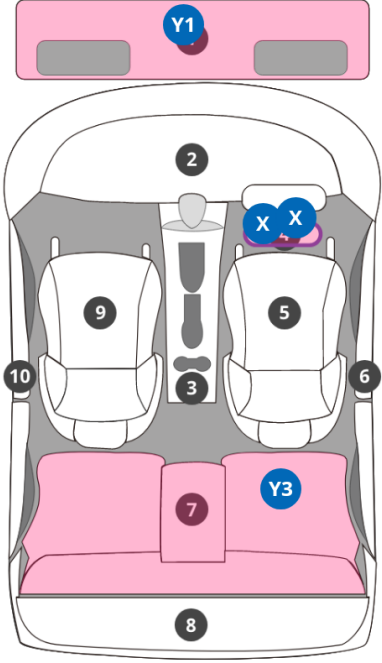
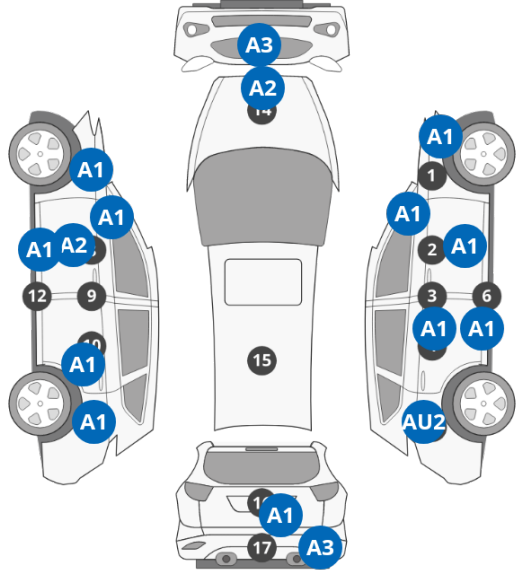
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	123	118	118
2	Boot Lid	119.6	119	122	118
3	Roof	117.0	118	129	110/111
4	Left Front Fender	107.6	110	104	109
5	Left Front Door	118.3	108	120	127
6	Center Panel Left				
7	Left Rear Door	114.0	113	110	119
8	Left Back Panel	115.3	121	108	117
9	Right Front Fender	104.3	110	108	95
10	Right Front Door	108.3	105	111	109
11	Center Panel Right				
12	Right Rear Door	108.0	115	103	106
13	Right Back Panel	114.3	118	103	122

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with spare tire and warranty booklet, 2keys, no jack and tools, scratches on headlights,