

General Information

Date & Time: 17, Jul, 2026 16:09

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	34,046
Registration No.	DBP6741	Chassis No.	MHKAB1B6RJ084123
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



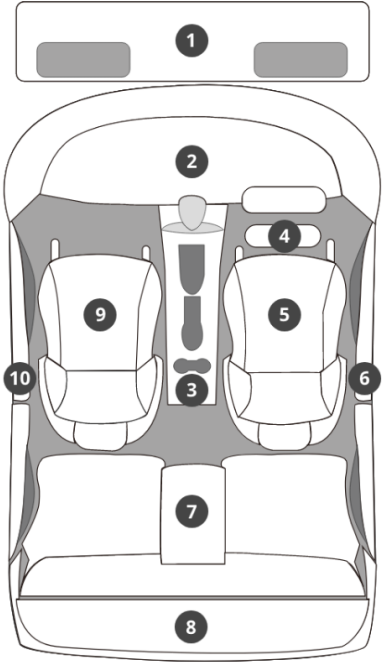
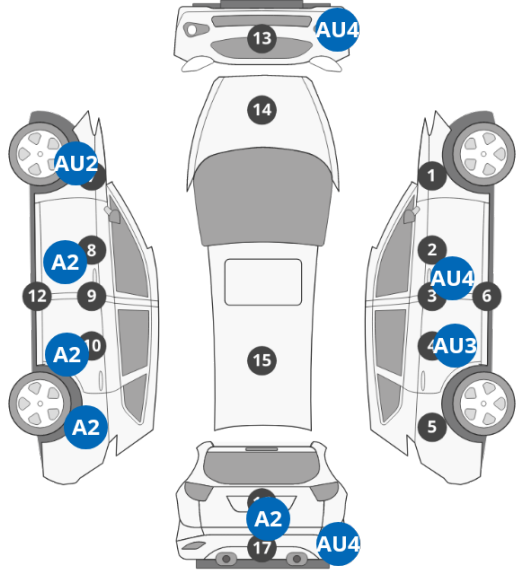
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	105	116	114
2	Boot Lid	88.2	84	96	85
3	Roof	97.5	100	105	94/91
4	Left Front Fender	90.2	89	99	82
5	Left Front Door	103.6	101	108	102
6	Center Panel Left				
7	Left Rear Door	99.6	103	100	96
8	Left Back Panel	88.0	87	83	93
9	Right Front Fender	83.8	82	92	78
10	Right Front Door	94.8	89	98	99
11	Center Panel Right				
12	Right Rear Door	87.5	89	87	86
13	Right Back Panel	84.1	83	83	87

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no jack and tools/ light scratches around the exterior/possible flooding/ temporary ORCR/with spare tire and LTO plate/ with warranty booklet/