

General Information

Date & Time: 20, Jul, 2026 14:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	41,727
Registration No.	EAJ4185	Chassis No.	PA1B18F30R4262195
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



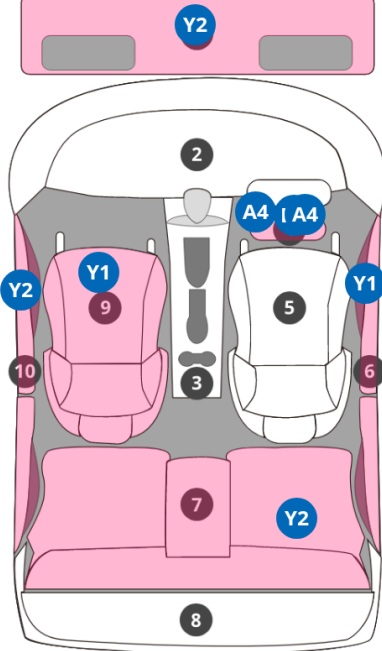
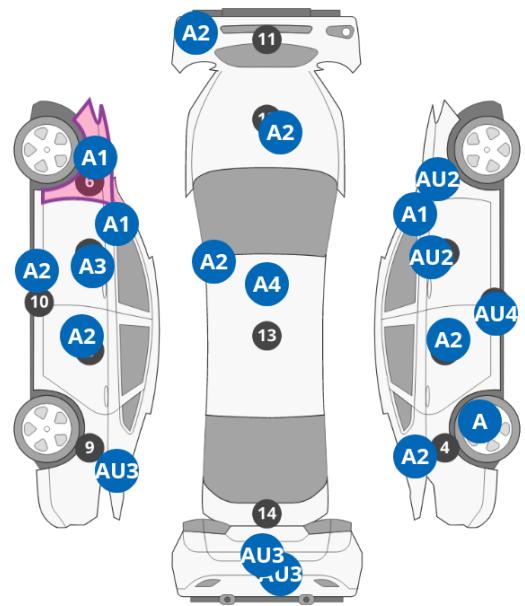
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	110	101	102
2	Boot Lid	118.0	113	123	118
3	Roof	96.5	101	92	94/99
4	Left Front Fender	310.6	266	232	434
5	Left Front Door	94.1	88	98	96
6	Center Panel Left				
7	Left Rear Door	104.6	110	104	100
8	Left Back Panel	112.6	122	107	109
9	Right Front Fender	100.8	99	104	99
10	Right Front Door	100.1	97	101	103
11	Center Panel Right				
12	Right Rear Door	100.0	94	102	104
13	Right Back Panel	105.4	105	99	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Large / Carpet - Worn, Scratch, Cut, Crack - Large	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Roof Spoiler, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Tyre - Crack, Cut - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet, 2 keys, no spare tire and jack and tools, scratches on headlights and taillights, worn front tires, visible hairlines scratches and stains on vehicle, carpet issue