

General Information

Date & Time: 17, Jul, 2026 16:18

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	36,138
Registration No.	NKS4932	Chassis No.	PA1B18F31S4286821
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



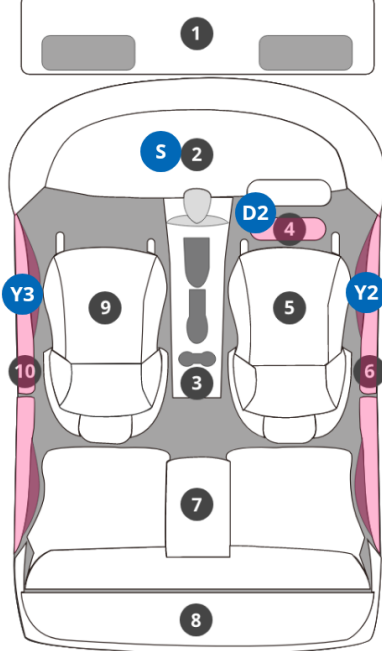
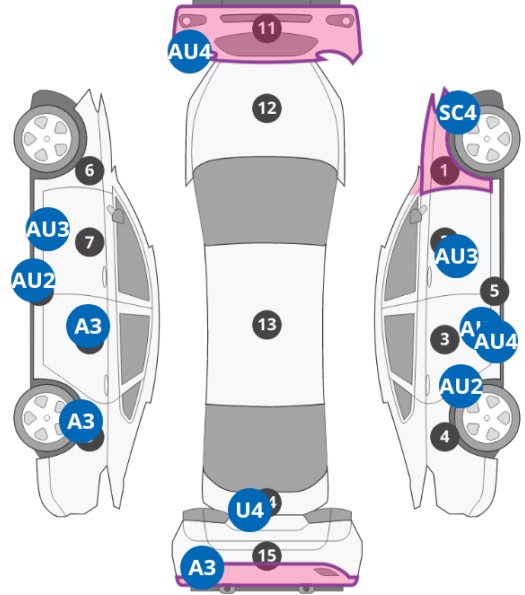
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	124	106	126
2	Boot Lid	110.3	102	111	118
3	Roof	106.5	106	114	95/111
4	Left Front Fender	102.3	100	101	106
5	Left Front Door	107.3	107	105	110
6	Center Panel Left				
7	Left Rear Door	106.6	115	105	100
8	Left Back Panel	118.6	125	115	116
9	Right Front Fender	332.3	307	295	395
10	Right Front Door	122.6	120	127	121
11	Center Panel Right				
12	Right Rear Door	116.0	111	109	128
13	Right Back Panel	116.6	119	111	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Rust, Corrosion - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
light scratches around the exterior/ with jack and spare tire/ with LTO plate and warranty booklet/ with tools