

General Information

Date & Time: 20, Jul, 2026 15:13

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	28,298
Registration No.	CCQ3238	Chassis No.	PA1B18F38S4293779
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



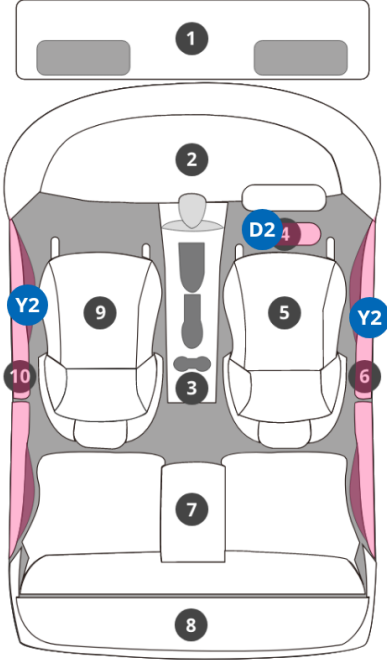
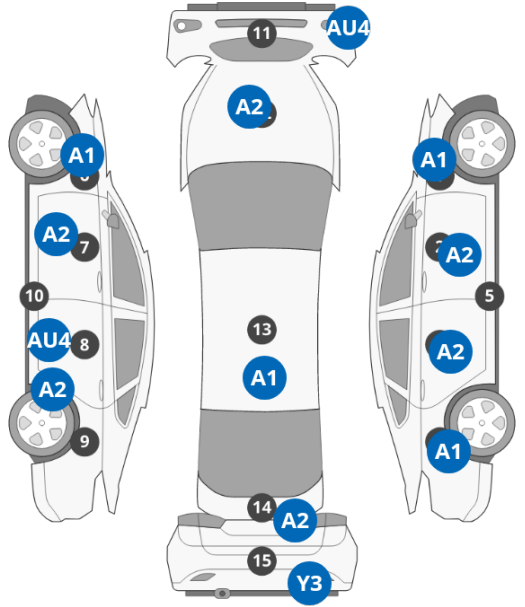
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	108	112	119
2	Boot Lid	116.0	112	121	115
3	Roof	108.7	120	104	104/107
4	Left Front Fender	108.0	116	106	102
5	Left Front Door	118.0	113	116	125
6	Center Panel Left				
7	Left Rear Door	116.0	124	110	114
8	Left Back Panel	118.6	119	119	118
9	Right Front Fender	102.2	100	102	105
10	Right Front Door	108.3	109	108	108
11	Center Panel Right				
12	Right Rear Door	110.3	106	112	113
13	Right Back Panel	118.0	122	105	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no tools and warranty booklet/ light scratches around the exterior/ with jack and spare tire/ with LTO plate