

General Information

Date & Time: 20, Jul, 2026 14:42

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,679
Registration No.	CCA8189	Chassis No.	PA1B18F30R4257949
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



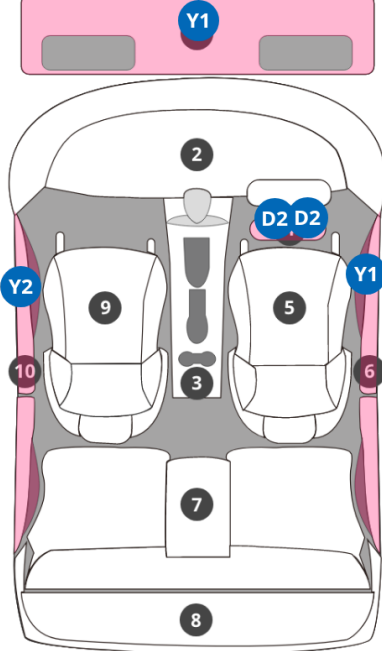
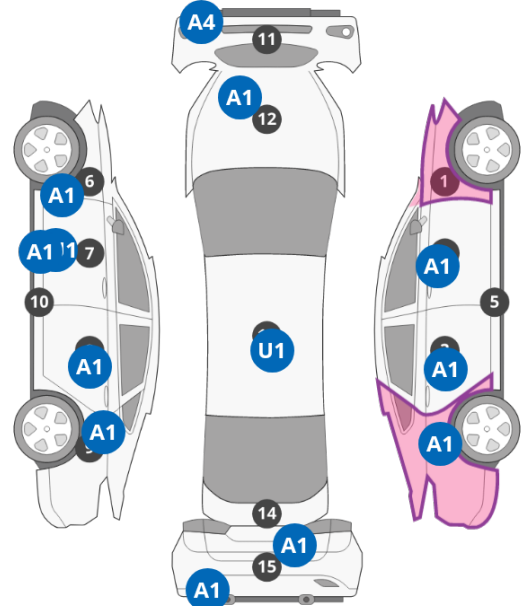
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	111	109	106
2	Boot Lid	115.6	121	107	119
3	Roof	99.5	110	94	100/94
4	Left Front Fender	107.6	106	108	109
5	Left Front Door	103.2	108	100	102
6	Center Panel Left				
7	Left Rear Door	113.6	120	112	109
8	Left Back Panel	112.0	120	111	105
9	Right Front Fender	156.6	174	152	144
10	Right Front Door	134.3	139	112	152
11	Center Panel Right				
12	Right Rear Door	103.6	109	91	111
13	Right Back Panel	496.0	165	333	990

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / Mat Other - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet and tools, 3keys, scratches on headlights and taillights