

General Information

Date & Time: 17, Jul, 2026 16:15

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	13,667
Registration No.	NLC2855	Chassis No.	PAHACACA3S6431346
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



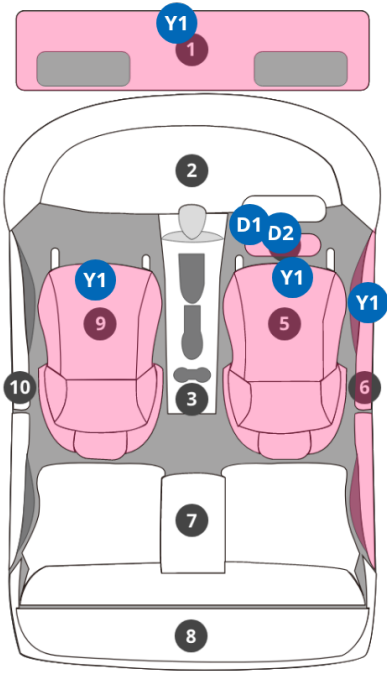
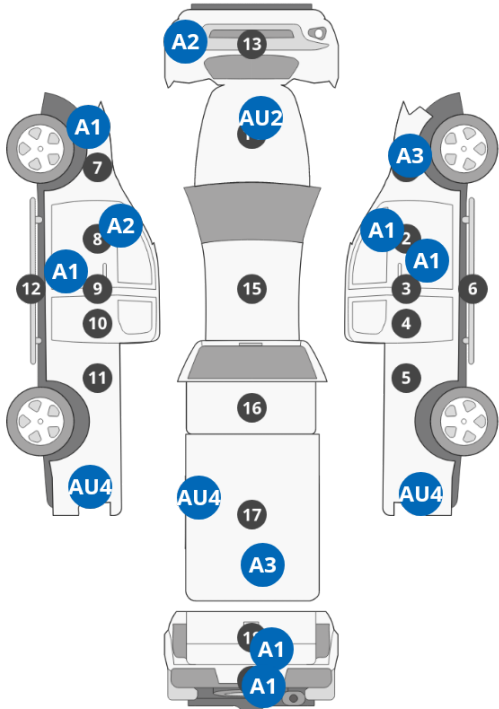
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	113	114	107
2	Boot Lid	67.2	68	62	72
3	Roof	126.0	135	122	118/129
4	Left Front Fender	119.0	113	117	127
5	Left Front Door	115.0	115	115	115
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	88.8	77	114	75
9	Right Front Fender	109.9	122	110	98
10	Right Front Door	110.3	106	113	112
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	86.8	85	85	90

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Large / Roof - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 2keys, no tools, scratches on headlights