

General Information

Date & Time: 20, Jul, 2026 15:16

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	52,173
Registration No.	NHS6320	Chassis No.	PA1B18F37R4262257
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



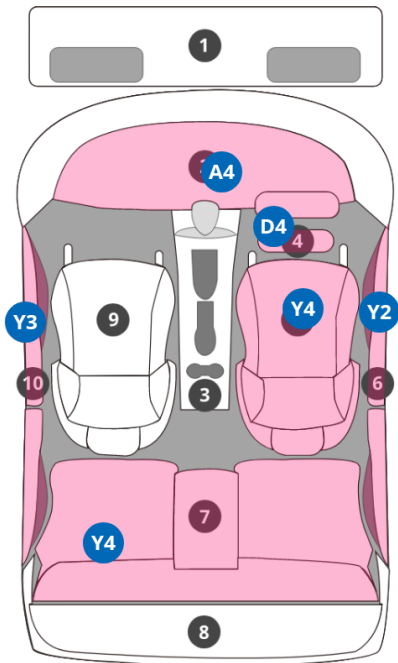
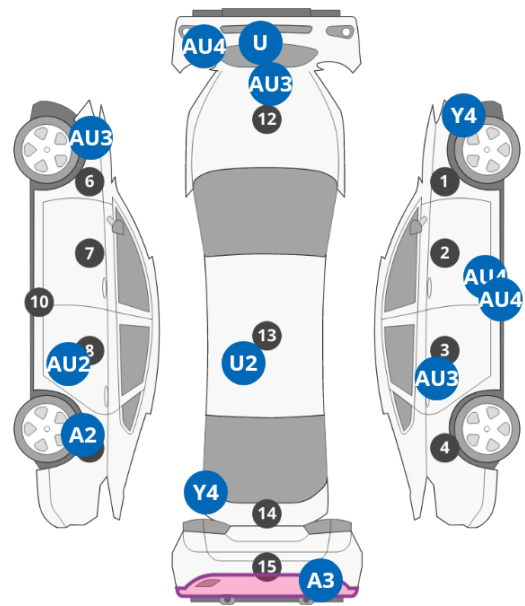
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	138	108	122
2	Boot Lid	116.0	115	112	121
3	Roof	112.2	116	110	116/107
4	Left Front Fender	104.0	106	106	100
5	Left Front Door	108.3	111	107	107
6	Center Panel Left				
7	Left Rear Door	114.3	113	113	117
8	Left Back Panel	120.3	119	120	122
9	Right Front Fender	111.0	112	110	111
10	Right Front Door	120.3	113	111	137
11	Center Panel Right				
12	Right Rear Door	127.0	127	127	127
13	Right Back Panel	126.0	115	128	135

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worn, Scratch, Cut, Crack - Large / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (L) Front Floor Mat - Worked - Large	Remarks Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Crack, Gap - Large / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

traction control light on/ worn tires/ABS warning light on/ airbag warning light on/ plate light issue/ possible flooding/ no tools/ light scratches around the exterior/ no spare tire/with jack and LTO plate/ with warranty booklet/