

General Information

Date & Time: 20, Jul, 2026 14:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,213
Registration No.	CCA8231	Chassis No.	PA1B18F332R4257449
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



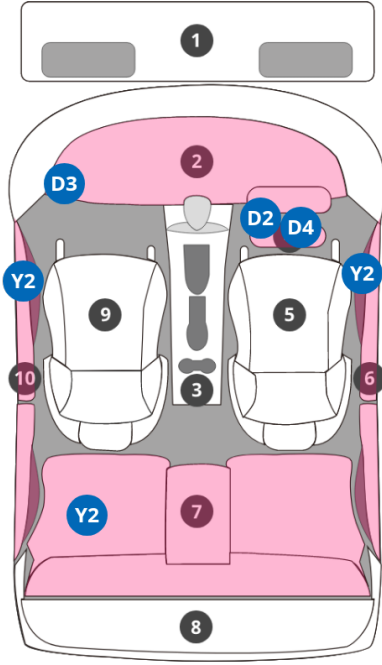
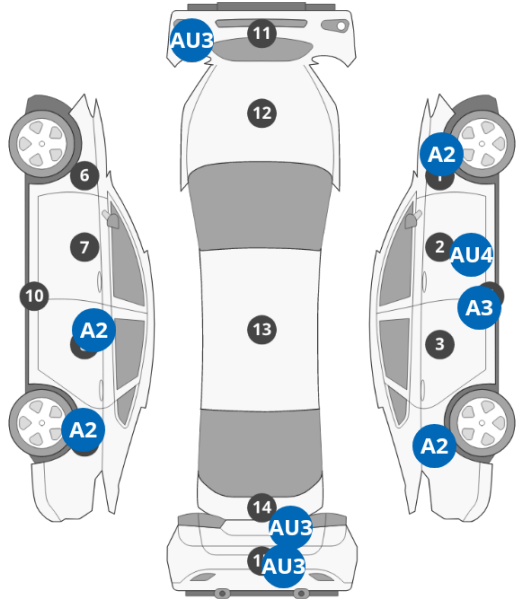
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	128	109	117
2	Boot Lid	109.0	109	110	108
3	Roof	110.2	108	102	120/111
4	Left Front Fender	101.8	104	96	106
5	Left Front Door	116.6	109	108	133
6	Center Panel Left				
7	Left Rear Door	107.3	120	101	101
8	Left Back Panel	115.3	117	113	116
9	Right Front Fender	107.3	106	107	109
10	Right Front Door	112.6	106	106	126
11	Center Panel Right				
12	Right Rear Door	112.0	105	106	125
13	Right Back Panel	121.6	118	111	136

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Loose, Deformed - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Large / Rear Seat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
check engine light on/ airbag warning light on/ maintenance warning light on/ traction control light on/ light scratches around the exterior/ incomplete tools/ with jack and spare tire/no warranty booklet/with LTO plate