

General Information

Date & Time: 03, Mar, 2025 10:22

Make	Toyota	Model	Vios
YOM	2024	Mileage	18,254
Registration No.	CBB6445	Chassis No.	PA1B18F31R4240447
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



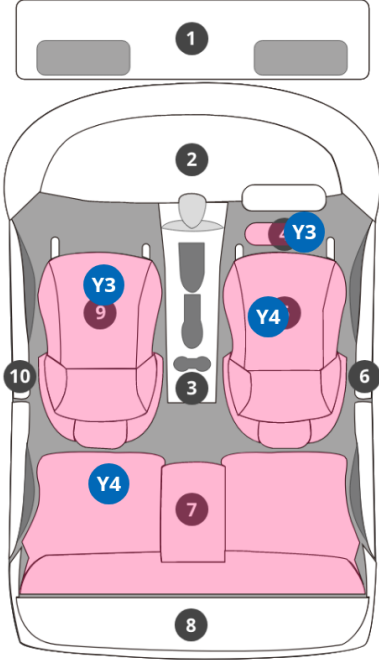
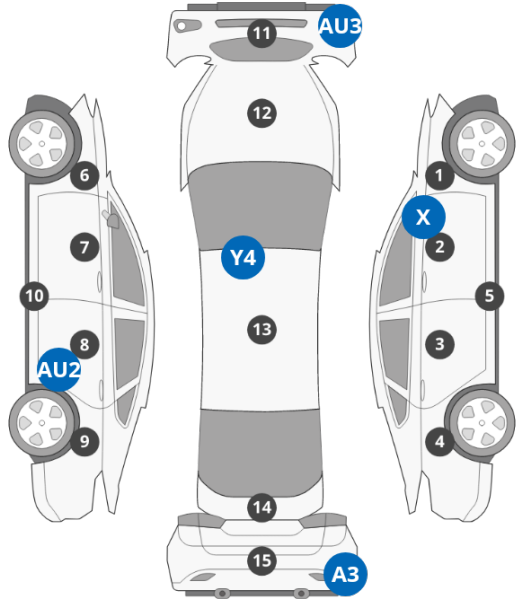
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.0	100	107	97
2	Boot Lid	104.5	99	110	105
3	Roof	91.6	95	89	87/95
4	Left Front Fender	92.0	92	87	97
5	Left Front Door	100.6	105	98	99
6	Center Panel Left				
7	Left Rear Door	99.8	105	100	94
8	Left Back Panel	107.3	117	103	102
9	Right Front Fender	100.6	95	98	109
10	Right Front Door	95.1	99	94	92
11	Center Panel Right				
12	Right Rear Door	93.5	91	90	100
13	Right Back Panel	105.0	102	104	109

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Medium	Remarks (R) Mirror - Stuck - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Front Windshield - Damaged - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/ with spare tire and jack/ with tools/ no warranty booklet/ damage front windshield